Equipment Check Guidelines for PMP Steel Tank Interstitial Sensors p/n 63420 and 63460 with TLS-300© & TLS-350© consoles

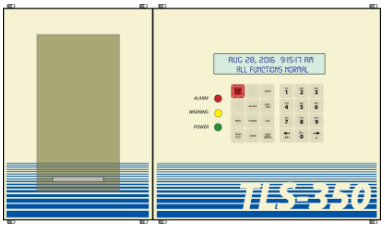

The purpose of this checklist is to provide regulators and inspectors quick access to information related to these sensors. This checklist cannot replace the Veeder-Root© console manuals and assumes that the console has been properly configured for a Veeder-Root 794380-420 and 794380-460 sensors.

For detailed operational instructions of the TLS-300 & TLS-350 consoles, please refer to the OEM manuals. For testing instructions, refer to the **Functional Test Procedure** shown in the product manual.

1. Sensors must be inspected annually. The station owner should refer to documentation such as the EPA's "Operating And Maintaining UST Systems" and PEI RP900-17 "Recommended Practices for the Inspection and Maintenance of UST Systems. These documents provide information for visual inspection of the sensor installation and operability. Operability testing procedures for this sensor can be found at the back of the PMP Steel Tank Interstitial Sensor manual.

2. Confirm the power is on to the TLS console. The green *Power* lamp should be the only lamp illuminated.

3. Verify there are no active alarms. Under normal circumstances the console will display "All Functions Normal" (see display at right).

4. Verify the sensor is sitting upright at the bottom of the riser pipe.

5. The sensor is a float switch design. It has three states when installed in the TLS console: Float Down, Float Up and Sensor Out. It is therefore programmed as a "Tri-State" sensor during the TLS setup.

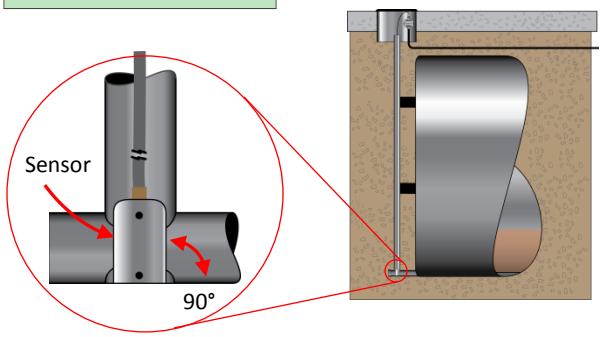

Float down
(normal)

Float up

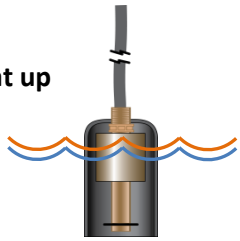

Sensor Out

Possible causes:
- Failed sensor
- Bad field connections
- Failed sensor cable
- Failed Interface Module

6. If liquid is detected, the console will go into alarm. The beeper will sound, the *Alarm* lamp will flash and the display will alternate between "All Functions Normal" and "Fuel Alarm".

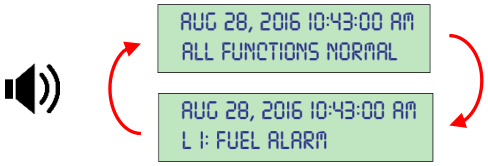

7. If the console cannot determine the status of the sensor, it will result in a "Sensor Out" alarm. A few examples of what might cause this alarm are; failed sensor, bad field connections, bad sensor cable, interface module etc.

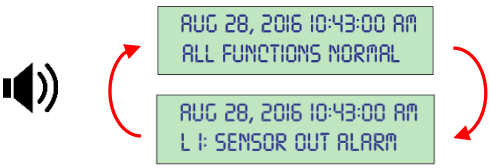

8. The beeper will continue to sound until the Alarm button is pushed to acknowledge the alarm.

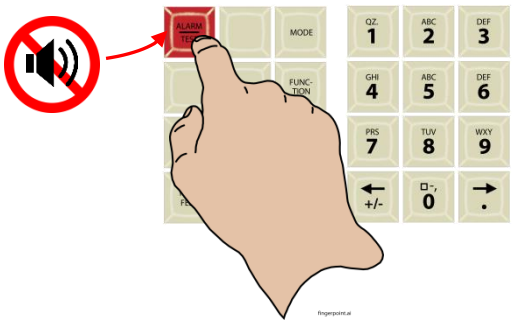

9. The *Alarm* lamp will continue to flash and the display will continue to alternate until the alarm condition has been addressed.

10. To review the alarm history of the console, follow the steps shown:

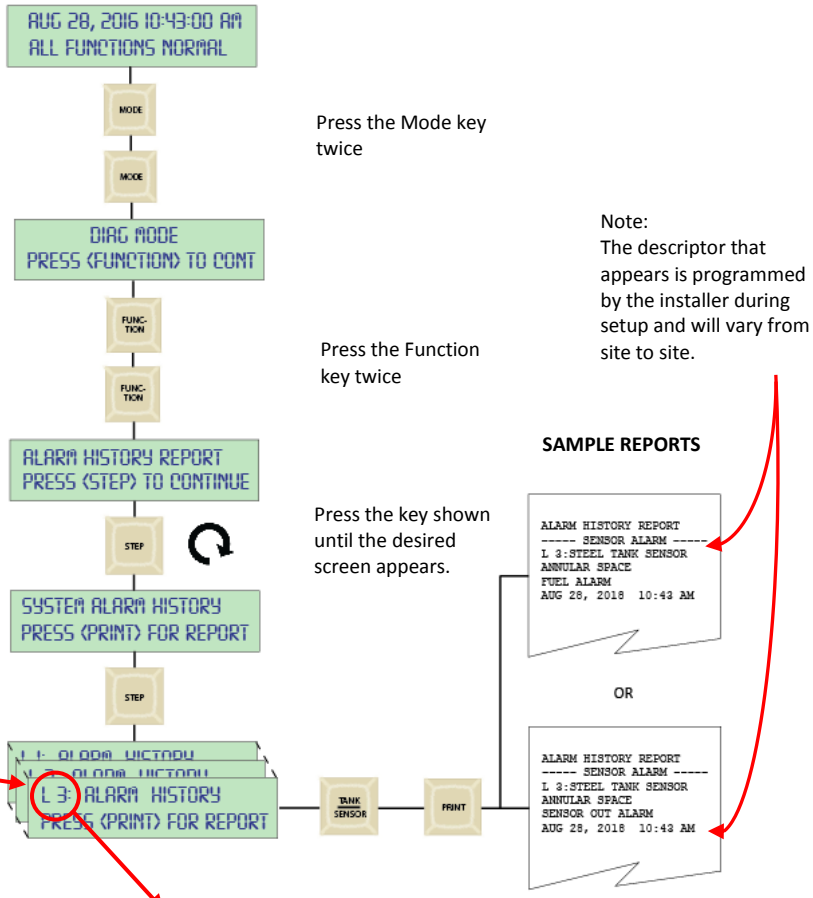

"L" indicates "Liquid". The number that follows is the position in-which the sensor is installed on the Interstitial Sensor Interface Module.

If there are more than 8 Liquid Sensors installed, the sensors installed on the next module would be assigned #9 – 16

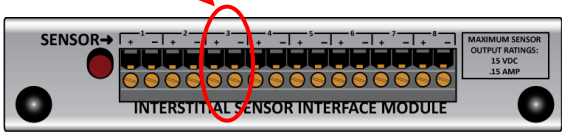

All product or company's names, trade names, trademarks, parts numbers and part descriptions may be the trademarks of their respective owners, and are used for reference or identification purposes only. PMP does not claim any right to or affiliation with such owners. The PMP product described here is manufactured or remanufactured and sold by PMP and is not the product of any other identified manufacturer.

PMP CORPORATION
P.O. Box 422 • 25 Security Drive
Avon, CT 06001

Local: 860-677-9656
Toll Free: 800-243-6628
Toll Free Fax: 888-674-0196
Web: www.pmp-corp.com
E-mail: sales@pmp-corp.com

A Veteran Owned and Managed Company

© PMP CORP