

HAMILTON
HERNANDO
PASCO

K-Σ

LEVEL BOOK

820040

Book #1

Dawson & Edens


Summer 1970

INDEX ON PAGE 79

DISTANCES FROM SIDE STAKES FOR CROSS-SECTIONING

Roadway of any Width. Side Slopes $1\frac{1}{2}$ to 1.

In the figure below: opposite 7 under "Cut or Fill" and under .3 read 11.0, the distance out from the side stake at left. Also, opposite 11 under "Cut or Fill" and under .1 read 16.7, the distance out from the side stake at right.

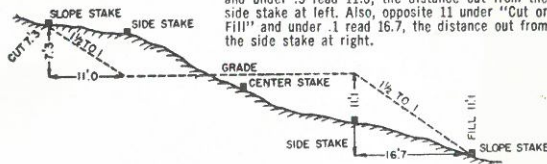

Cut or Fill	0	.1	.2	.3	.4	.5	.6	.7	.8	.9	Cut or Fill
	Distance out from Side or Shoulder Stake										
0	0.0	0.2	0.3	0.5	0.6	0.8	0.9	1.1	1.2	1.4	0
1	1.5	1.7	1.8	2.0	2.1	2.3	2.4	2.6	2.7	2.9	1
2	3.0	3.2	3.3	3.5	3.6	3.8	3.9	4.1	4.2	4.4	2
3	4.5	4.7	4.8	5.0	5.1	5.3	5.4	5.6	5.7	5.9	3
4	6.0	6.2	6.3	6.5	6.6	6.8	6.9	7.1	7.2	7.4	4
5	7.5	7.7	7.8	8.0	8.1	8.3	8.4	8.6	8.7	8.9	5
6	9.0	9.2	9.3	9.5	9.6	9.8	9.9	10.1	10.2	10.4	6
7	10.5	10.7	10.8	11.0	11.1	11.3	11.4	11.6	11.7	11.9	7
8	12.0	12.2	12.3	12.5	12.6	12.8	12.9	13.1	13.2	13.4	8
9	13.5	13.7	13.8	14.0	14.1	14.3	14.4	14.6	14.7	14.9	9
10	15.0	15.2	15.3	15.5	15.6	15.8	15.9	16.1	16.2	16.4	10
11	16.5	16.7	16.8	17.0	17.1	17.3	17.4	17.6	17.7	17.9	11
12	18.0	18.2	18.3	18.5	18.6	18.8	18.9	19.1	19.2	19.4	12
13	19.5	19.7	19.8	20.0	20.1	20.3	20.4	20.6	20.7	20.9	13
14	21.0	21.2	21.3	21.5	21.6	21.8	21.9	22.1	22.2	22.4	14
15	22.5	22.7	22.8	23.0	23.1	23.3	23.4	23.6	23.7	23.9	15
16	24.0	24.2	24.3	24.5	24.6	24.8	24.9	25.1	25.2	25.4	16
17	25.5	25.7	25.8	26.0	26.1	26.3	26.4	26.6	26.7	26.9	17
18	27.0	27.2	27.3	27.5	27.6	27.8	27.9	28.1	28.2	28.4	18
19	28.5	28.7	28.8	29.0	29.1	29.3	29.4	29.6	29.7	29.9	19
20	30.0	30.2	30.3	30.5	30.6	30.8	30.9	31.1	31.2	31.4	20
21	31.5	31.7	31.8	32.0	32.1	32.3	32.4	32.6	32.7	32.9	21
22	33.0	33.2	33.3	33.5	33.6	33.8	33.9	34.1	34.2	34.4	22
23	34.5	34.7	34.8	35.0	35.1	35.3	35.4	35.6	35.7	35.9	23
24	36.0	36.2	36.3	36.5	36.6	36.8	36.9	37.1	37.2	37.4	24
25	37.5	37.7	37.8	38.0	38.1	38.3	38.4	38.6	38.7	38.9	25
26	39.0	39.2	39.3	39.5	39.6	39.8	39.9	40.1	40.2	40.4	26
27	40.5	40.7	40.8	41.0	41.1	41.3	41.4	41.6	41.7	41.9	27
28	42.0	42.2	42.3	42.5	42.6	42.8	42.9	43.1	43.2	43.4	28
29	43.5	43.7	43.8	44.0	44.1	44.3	44.4	44.6	44.7	44.9	29
30	45.0	45.2	45.3	45.5	45.6	45.8	45.9	46.1	46.2	46.4	30
31	46.5	46.7	46.8	47.0	47.1	47.3	47.4	47.6	47.7	47.9	31
32	48.0	48.2	48.3	48.5	48.6	48.8	48.9	49.1	49.2	49.4	32
33	49.5	49.7	49.8	50.0	50.1	50.3	50.4	50.6	50.7	50.9	33
34	51.0	51.2	51.3	51.5	51.6	51.8	51.9	52.1	52.2	52.4	34
35	52.5	52.7	52.8	53.0	53.1	53.3	53.4	53.6	53.7	53.9	35
36	54.0	54.2	54.3	54.5	54.6	54.8	54.9	55.1	55.2	55.4	36
37	55.5	55.7	55.8	56.0	56.1	56.3	56.4	56.6	56.7	56.9	37
38	57.0	57.2	57.3	57.5	57.6	57.8	57.9	58.1	58.2	58.4	38
39	58.5	58.7	58.8	59.0	59.1	59.3	59.4	59.6	59.7	59.9	39
40	60.0	60.2	60.3	60.5	60.6	60.8	60.9	61.1	61.2	61.4	40



The paper in this book is made of 50% high grade rag stock with a WATER RESISTING surface sizing.

KEUFFEL & ESSER CO.

J W-6300		BS	LEVEL	FS	ELEV
BM					126
TP ₁	2	4.58	130.58	2.5	121.46
TP ₂		0.24	121.64	11.18	109.46
TP ₃		6.33	109.79	9.46	100.33
TP ₄		0.09	100.42	0.12	100.30
TP ₅		10.06	110.36	1.06	109.30
TP ₆		11.08	120.38	0.08	120.30
TP ₇		8.25	128.55	1.49	127.06
TP ₈		6.52	133.58	5.28	128.60
TP ₉		5.30	133.90	4.84	129.06 Elev
		46.45		42.69	
		<u>42.69</u>			
		3.76			

Corrected Elev.
Ground - 129.76'

HAMILTON CO

JUNE 17, 1970

OWNER - State Road Dept.

BM - U.S.G.S. BM - ET 5 WCE, 1959,
126'

Hot, partly cloudy

SAM - ROD

MARK - LEVEL

LOCATION - 15, 14E, Sec 24, NE 1/4 SW 1/4
(bc)

Well located in small pump
house behind weigh station,

W-7826	BS	LEVEL	FS	ELEV
BM				154
TP ₁	5.40	159.40	4.77	155.63
TP ₂	2.16	157.79	7.23	150.56
TP ₃	5.37	155.93	4.74	151.19 TBM
TP ₄	4.01	155.20	4.12	151.08 casing
	16.94		5.06	150.14 Ground

154.00	20.86
<u>3.92</u>	<u>16.94</u>
150.08	3.92

Corrected Elev

150.08' casing

149.14' Ground

HAMILTON CO. June 12, 1970

Owner - City of Jasper

BM - USCG Survey BM, Jasper, 1934
Elev. 154'


Hot, partly cloudy day

Sam - Rod

Mark - Level

Location - T1N, R14E, Sec 5, NW 1/4, PMNH
(a.a)

Well located
in pump house

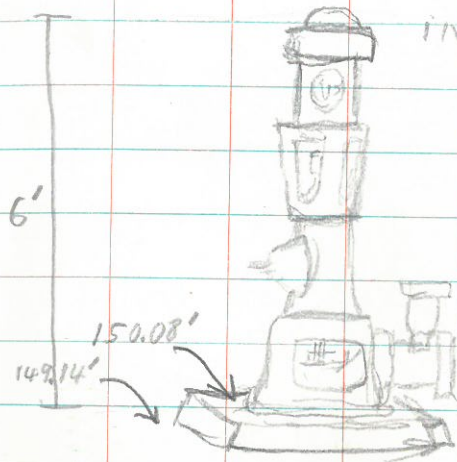

W-6845	BS	LEVEL	FS	ELEV
BM				109'
TP ₁	1.49	110.49	7.15	103.34
TP ₂	2.64	105.98	11.11	94.87
TP ₃	6.87	95.74	11.31	84.43
TP ₄	3.56	87.99	8.88	79.11 Ground
	8.56		8.30	79.69 Casing

109.00
 29.89
 79.11

384.5
 8.56
 29.89

Hamilton Co. June 17, 1970

Owner - S.L. Scott

BM - U.S.G.S. BM, LAN 25, 1954,


Elev. - 109'

Hot, partly cloudy

SAM - ROD

MARK - LEVEL

Location - TIN, RIBE, Sec 6, NE 1/4 SW 1/4
 (bc)

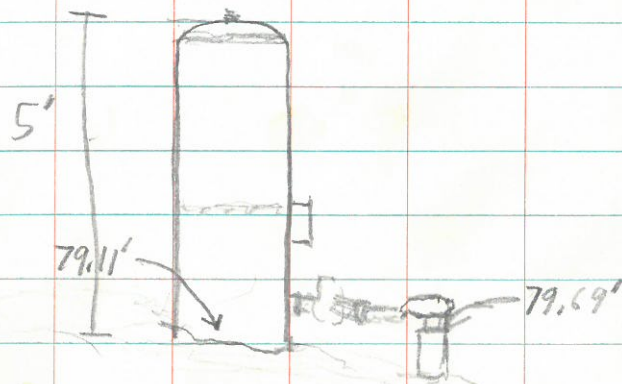

W-7635 BS LEVEL FS ELEV
 BM 79.69
 TP₁ 8.30 87.99 6.29 81.70
 TP₂ 5.84 87.54 3.74 83.80 Casing
 WELL #1 4.07 83.47 Ground
 WELL #2 6.94 80.60 Casing
 7.87 79.67 Ground

Well #1 located in parking lot
 near restaurant under metal
 slab. 83.80'




Hamilton Co June 17, 1970
 Owner - American Oil Co.
 BM - See W-6845 on page 3.

Hot partly cloudy
 SAM - ROD

MARK-LEVEL

Location - T1N, R13E, Sec 6, SE 1/4 of NW 1/4
 (dca)

Well 2

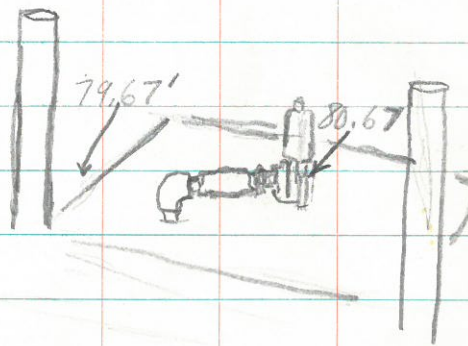

J Pinetta Core				
W-BASS#	BS	LEVEL	FS	ELEV
BM				98.8
TP ₁	3.37	102.17	11.47	90.70
TP ₂	1.40	92.10	10.88	81.22
TP ₃	4.24	85.46	5.10	80.36
TP ₄	5.02	85.38	6.47	78.91
TP ₅	3.40	82.31	5.11	77.20
TP ₆	7.36	84.56	4.55	80.01
TP ₇	6.04	86.05	3.20	82.85
	30.83		46.78	Ground
			30.83	
			15.95	
	98.80			
	15.95			
	82.85			

Withlatchoochee River CORE HOLE
Madison Co. June 18, 1970

Owner - Bureau of Geology core

BM - U.S. Engineer Dept., Harbor Survey

BM, EDT...714, Elev. 98.8' MSL.

Hot, Clear Morning

Sam - Rod

Mark - Level

Location - Sec 206 Near Ga.
Line

Bureau of Geology corehole.

Filled & abandoned.

Quarry BS LEVEL FS ELEV

assumed 100.00

TP₁ 7.57 107.57 2.35 105.22
 TP₂ 3.46 108.68 6.70 101.98 TBM

1103 9.05

BM 106'

TP₁ ^{2 2} 4.68 110.68 ^{2 2} 3.53 107.15

TP₂ 6.55 113.70 3.87 109.83

TP₃ 8.92 118.75 1.38 117.37

TP₄ 8.66 126.03 0.77 125.26

TP₅ 28.81 9.55

1103 28.81 125.26
 9.05 9.55
 1.98 19.26 101.98

23.28

100.00

+ 5.00

128.28

Elev at quarry 128.28'

Swansea Co June 19, 1970

Owner - Swansea Mining Co.

BM - TOPO Road elev. 106'

Hot, Clear morning.

Sam - Rod

Mark - level

Location - T2S-R13E-Sect 3-NE 1/4 NW 1/4

Elevation of rock section

at Live Oak Quarry.

Ellaville
#3

BS LEVEL FS Elev

BM 3.2 5.2 59'

TP₁ 2.63 60.63 1.63 60.00

TP₂ 5.12 65.12 8.60 56.32

TP₃ 4.40 60.72 3.36 57.36

TP₄ 4.47 61.83 3.56 58.27

TP₅ 2.32 60.59 2.53 58.06

TP₆ 3.62 61.68 4.84 56.84

TP₇ 6.50 63.34 4.74 58.60

TP₈ 5.19 63.79 3.92 ~~59.87~~ Ground

34.25 33.18

33.18
1.07

Corrected Elev 60.07' Ground

Madison Co. June 19/1970

Owner - Bureau of Geology

BM - Elev. of bridge assumed

from BM near that point. 59

Hot, partly cloudy afternoon

Sam - Rod

Mark - Level

Location - T15-R11E-Sc14-SW1/4 of NW1/4

(c, a)

Bureau of Geology core

hole to be drilled at this

location Ellaville #2

✓ Ellenville #4 B5 LEVEL FS ELEV

BM 73'

TP₁ 3.74 76.74 5.89 76.85

TP₂ 5.02 75.88 7.45 68.43

TP₃ 7.94 76.37 6.69 69.68

TP₄ 2.35 72.03 10.28 61.75

TP₅ 3.27 65.02 5.91 59.11

TP₆ 5.85 64.96 6.01 58.95

TP₇ 6.15 65.10 4.07 61.03

Ground

Hamilton Co. June 19, 1970

Owner - Bureau of Geology

BM - Topo road elevation

Elev. - 73'

Hot, partly cloudy afternoon

Sam - Rod

Mark - Level

Location - T15-R11E-Section NW 1/4 of NE (a, b)

Bureau of geology core hole to be drilled.

JW-4114 B.S. Level FS Elev.

B.M.

149.893

TP, 1.14 151.03 8.42 142.61 Ground

Hernando Co.

June 23, 1970

Owner - City of Brooksville
B.M. City Engineers - North bolt
of fire hydrant on Lamar
& Main.

Elev. - 149.893

Warm - partially cloudy

Sam - Level

Mark - Rod

Location - T22S, R19E, Sec. 22,
SW $\frac{1}{4}$ of SE $\frac{1}{4}$ (4d)

Located in Locked Pump house
on corner of Lamar & Main
in Brooksville, Fla.

J W-10299 BS		LEVEL	FS	Elev
BM				124'
TP ₁	5.5	24		
	4.47	128.47	1.85	126.62
TP ₂	11.83	138.45	0.05	138.40
TP ₃	11.27	149.67	0.08	149.59
TP ₄	11.38	160.97	0.09	160.88
TP ₅	11.83	172.71	6.48	166.23
TP ₆	11.59	177.82	2.01	175.81
TP ₇	11.26	187.07	1.37	185.70
TP ₈	11.96	197.66	0.06	197.60
TP ₉	9.06	206.66	0.70	205.96
TP ₁₀	4.91	210.87	5.30	205.57
	99.56	17.99		
	17.99			
	81.57			
	124.00			
	205.57'			

Ground

Hernando Co. June 23, 1970

Owner - Walter Bielenberg

BM - RR intersection off top

Elev. 124'

Hot, partly cloudy afternoon

Sam - Red

Mark - Level

Location - T22S, R19E, Sec 34,

NE 1/4 SW 1/4 (b, c)

Well located in locked pump house.

Check Well Sheet

W-8604 BS LEVEL FS Elev

BM Well # 1 88.030

TP₁ 4.35 92.38 9.03 83.35

TP₂ 5.45 88.80 4.26 84.54 Casing
5.36 83.44 Ground

Well # 2 84.54

TP₁ 4.26 88.80 3.07 85.73

TP₂ 5.83 91.56 4.11 87.45 Gnd.
3.83 87.73 Casing

Hernando Co. June 24, 1970

Owner - C. E. Baird

BM. - SRD south


Elev. - 88.030 given by
U.S.C. & G.S.

Hot, partly cloudy morning

Sam - Level

Mark - Rod

Location - T22S-R19E-Sec 28-SW 1/4 of SE
(C, d)

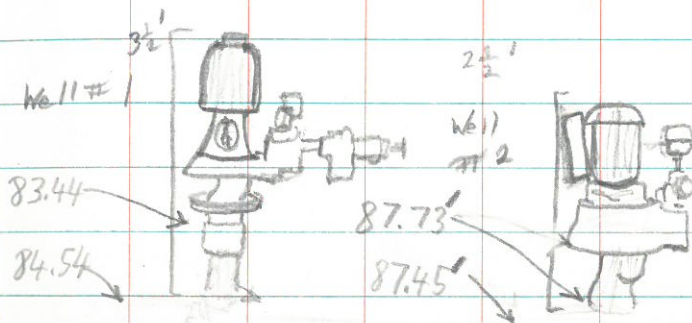

W-10354	BS	LEVEL	FS	Elev
BM				55
TP ₁	5.37	60.37	3.00	57.37
TP ₂	<u>5.51</u>	<u>62.88</u>	<u>1.10</u>	<u>61.78</u> Ground
	10.88		4.10	
	<u>4.10</u>			
	6.78			
	<u>55.00</u>			
	61.78			

Hernandez Co June 24, 1970

Owner - Deltona Corp

BM - BM established by Spring

Hill engineers from USCG.

Elev. - 55'

Cloudy & cool afternoon

Sam - Rod

Mark - Level

Location - 23S-18E-Sec 21-SE 1/4 of SW 1/4 (d.)

Well located in locked pump house.

W-10319	BS	LEVEL	FS	ELEV
BM				32'
TP ₁	2.37	34.37	4.87	29.50
TP ₂	4.71	34.21	4.60	29.61
TP ₃	4.74	34.35	4.79	29.56
TP ₄	5.59	35.15	1.06	34.09
TP ₅	8.57	42.66	1.03	41.63
TP ₆	9.17	50.80	6.46	50.34
TP ₇	9.29	59.63	0.60	59.03
TP ₈	5.46	64.49	2.37	62.12
TP ₉	9.55	71.67	5.44	66.23
TP ₁₀	9.95	76.18	0.02	76.16
TP ₁₁	7.15	83.31	10.39	72.92
TP ₁₂	0.62	73.54	12.66	60.88
TP ₁₃	5.30	66.18	1.80	64.38
TP ₁₄	6.06	70.44	3.80	66.64
TP ₁₅	16.25	76.89	0.15	76.74
TP ₁₆	11.83	88.57	1.11	87.46

Hernando Co June 24, 1970

Owner - Charles M. Sasser

BM - U.S. G.S. BM T T 18 JA, 1952

Elev - 32'

Hot & partly cloudy afternoon


Sam - Rod

Mark - Level

Location - 22S-18E-29-SE $\frac{1}{4}$ of NE $\frac{1}{4}$ (d, h)

W-10319	BS	LEVEL	FS	Elev
---------	----	-------	----	------

TP ₁₇	5.88	93.34	5.24	88.10	Casing
			5.97	87.37	Ground

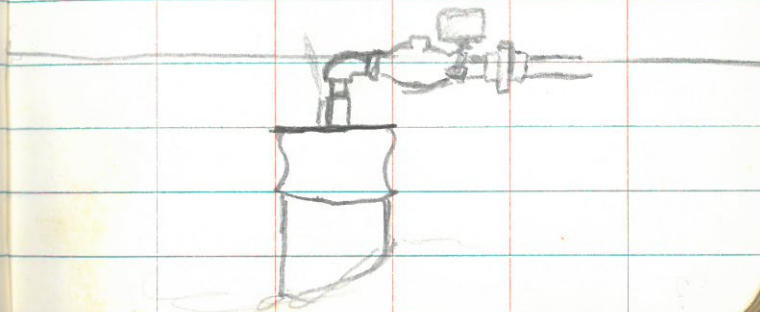

W-5754 BS LEVEL FS Elev

BM assumed 50

casing 5.46

TP ground 6.14 56.14 6.79 49.35

TP₂ 3.73 53.08 7.91 45.07

TP₃ 0.12 45.19 10.16 35.03

TP₄ 9.99 24.86

9.99
4.87

River level 3.21

Sea level correction 38.396

~~41.606~~

41.61'

35.03

correction — 6.58

Elev Ground ~~56.58'~~ 56.68'

Casing ~~57.56'~~ 57.66'

Hernando Co. June 25, 1970

Owner - Suncoast Girl Scout Council

BM - Harbor Survey BM


STA F.D.A. 76 1935 Elev. 51'

Hot, Cloudy, Morning

Sarm - Rod

Mart - Level

Location - T22S-R21E-Sec 15-NW 1/4 (a,c)

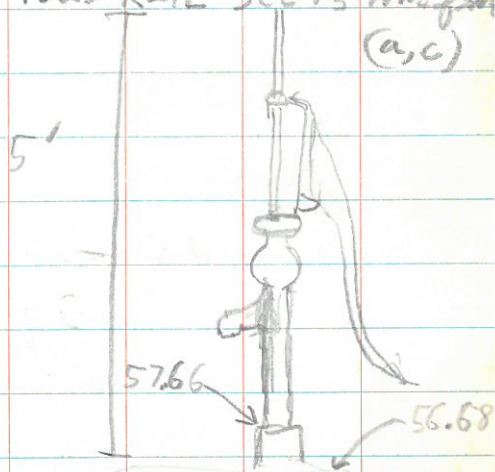

W-7737 B.S. LEVEL FS Elev
 BM 41.61'
 TP₁ 8.73 50.34 1.84 48.50
 TP₂ 9.75 58.25 2.37 55.88
 TP₃ 4.77 60.65 4.90 55.75' casing
 TP₄ 5.26 55.39' ground
 23.25 9.11

23.25
 9.11
 14.14
 41.61
 55.75

Hernando Co. June 25, 1970

Owner - Fla. Board of Parks


BM - River level from gaging station 41.61'

Hot, Cloudy, afternoon

Sam - Rod

Mark - Level

Location - T225-R21E-sec8-
 SE $\frac{1}{4}$ of SE $\frac{1}{4}$ (d,d)

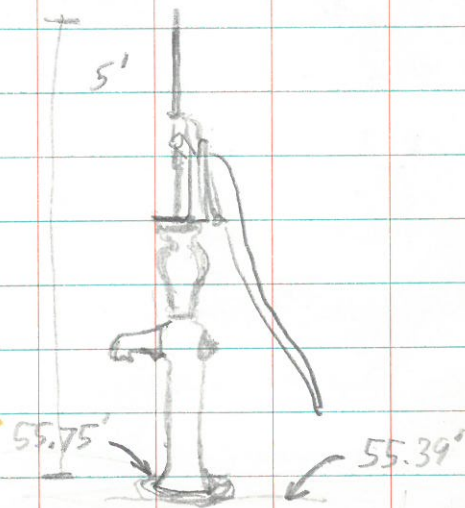

W-4205 BS LEVEL FS Elev

BM 3 5 4 4 94.859'

TP₁ 8.45 103.31 1.67 101.64

TP₂ 9.29 110.93 2.36 108.57

TP₃ 9.01 117.58 1.21 116.37

TP₄ 10.24 126.61 0.25 126.36

TP₅ 8.94 135.30 11.69 123.61

TP₆ 1.14 124.75 1.84 122.91

TP₇ 9.28 132.19 1.11 131.08

TP₈ 5.14 136.22 1.50 134.72

TP₉ 5.08 139.80 10.50 129.30

TP₁₀ 2.52 131.82 7.39 124.43

TP₁₁ 5.74 130.17 2.06 128.11

Ground

74.83 0.27 129.90

Casing

41.58 41.58

33.25

94.86

128.11

Hernando Co June 26, 1970

Owner - W. P. McDonald Corp

BM - U.S.C. & G.S. BM, F.54

Elev - 94.859'


Hot, cloudy morning

Sam - Rod

Mark - Level

Location - T22S-R20E - Sec 19

NE 1/4 of SW 1/4 (Q-2)

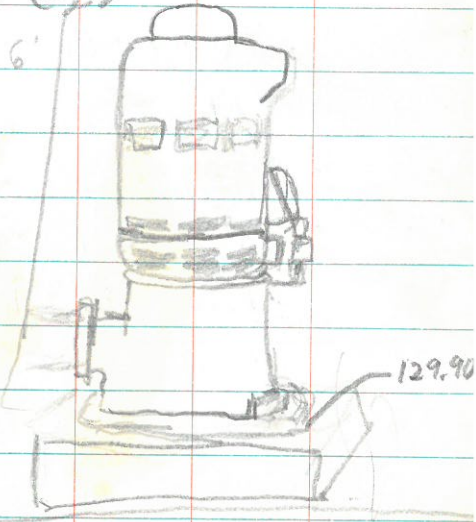

W-8426	BS	LEVEL	FS	ELEV
BM	277		465	141'
TP ₁	11.04	152.04	0.00	152.04
TP ₂	11.30	163.34	0.81	162.53
TP ₃	11.42	173.95	0.40	173.55
TP ₄	11.58	185.13	0.28	184.85
TP ₅	11.87	196.72	0.43	196.29
TP ₆	10.64	206.93	0.07	206.86
TP ₇	10.02	216.82	10.61	206.21
TP ₈	0.15	206.36	11.11	195.25
TP ₉	0.54	195.79	12.00	183.79
TP ₁₀	0.79	184.58	11.89	172.69
TP ₁₁	0.81	173.50	11.81	161.69
TP ₁₂	0.48	162.17	11.83	150.34
TP ₁₃	1.11	151.45	7.55	143.90
TP ₁₄	0.51	144.41	9.49	134.92
TP ₁₅	8.85	143.77	3.00	140.77
TP ₁₆	4.79	145.56	5.45	140.11 casing
			6.18	139.38 Ground

17

Hernando Co. June 26, 1970

Owner - Southern Mennonites
Assoc.

BM - Topo road elev. 141'

Hot, cloudy afternoon.

Sam - Rod

Mark - Level


Location - T23S-R20E-Sec 32

NW 1/4 of SE 1/4 (a, d)

Corrected elev.

140.17 casing


139.44 ground

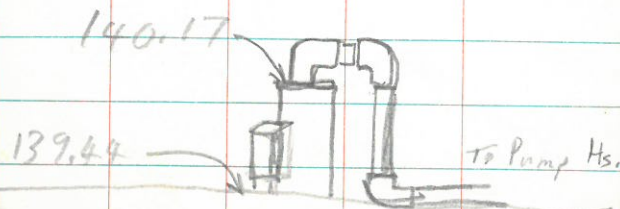

W-8211	BS	LEVEL	FS	ELEV
BM	23	33		160.681
TP ₁	11.09	171.77	0.02	171.75
TP ₂	11.03	182.78	0.18	182.60
TP ₃	11.72	194.32	0.53	193.79
TP ₄	10.19	203.98	4.64	199.34
TP ₅	1.21	200.55	11.63	188.92
TP ₆	0.96	189.88	11.86	178.02
TP ₇	2.79	180.81	0.79	180.02
	48.99	29.65	181.03	Casing
	29.65			
	19.34			
	160.68			
	180.02			

Hernando Co. June 29, 1970
 Owner - City of Brooksville
 BM - South end of concrete
 culvert at intersection Whiteway
 Drive & Hammock Rd. Elev - 160.681
 Sam - Rod
 Mark - Level
 Cool, partly cloudy morning.


Location - T22S-R19E-Sec 15
 NW 1/4 of SE 1/4 (a, d)

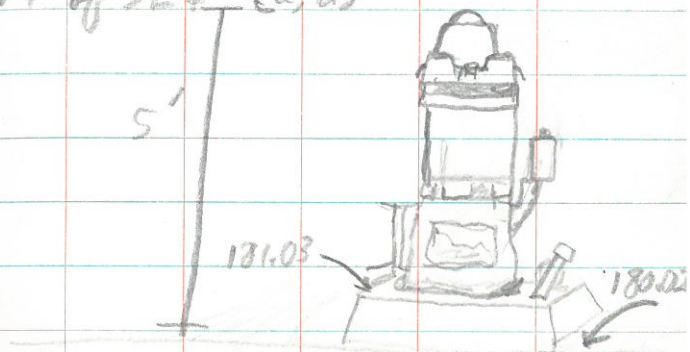

W-8508	BS	Level	FS	Elev
BM	22	23		79.0'
TP ₁	7.35	86.35	4.06	82.29
TP ₂	4.95	87.24	6.84	80.35
TP ₃	3.64	83.99	0.37	83.62
TP ₄	11.35	94.97	4.27	90.70
TP ₅	11.00	101.70	1.90	99.80
TP ₆	4.54	104.34	2.40	101.94 Grd.
	42.83		1.83	102.51 casing
	19.89			
	22.94		19.90	
	79			
	101.94			

Hernando Co June, 29, 1970
 Owner - E. Coast University
 B.M. - Topo road elevation
 at intersection of Hwy. 50
 and Cedar Lane. Elev. 79'
 Sam - Level
 Mark - Rod
 Hot - Partly cloudy
 afternoon

Location - T 22S - R 20E - Sec 31
 SW 1/4 of NE 1/4 (c, b)

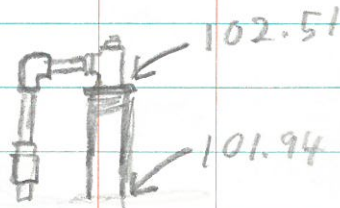

W-8429 BS LEVEL FS ELEV

B.M. 88.030

TP₁ 8.03 96.06 0.01 96.05

TP₂ 6.14 112.19 6.22 105.97

TP₃ 5.11 111.08 0.74 ~~110.34~~ Ground

19.28

6.97

6.97

12.31

88.03

100.34

Corrected Elev

100.34'

Hernando Co. June 29, 1970

Owner - Brooksville Christian Church

B.M. - SRD South, B.M. running

by U.S.C. & G.S. Elev. - 88.030

Hot, partly cloudy afternoon

Sam - Rod

Muck - Level

Location - T22S-R19E, Sec 28

SE 1/4 of SE 1/4 (dd)

Well located in locked pump house.

W-4408 BS Level FS Elev.

BM 99'

TP, 11.50 110.50 0.08 110.42

TP, 8.01 118.43 3.77 114.66 Grd.

19.51 2.69 115.74 Casing

3.85

15.66

99.

114.66

Hernando Co.

June, 29, 1970

Owner - Wesleyan Methodist
Conference

B.M. - T.22.5., R.19E.


Common corner of Sec
23, 24, 25, 26. Elev. - 99'

Hot, Partly cloudy, afternoon

Sam - Level

Mark - Red

Location - T225-R19E - Sec 25,
NW $\frac{1}{4}$ of NW $\frac{1}{4}$ (a, a)
2'

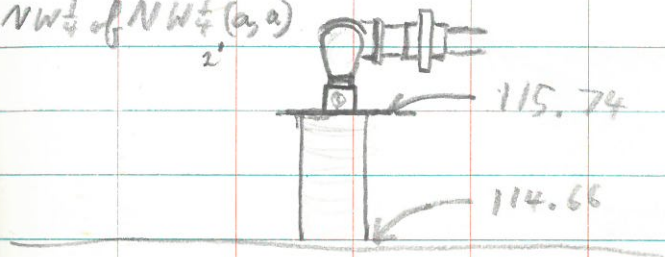

W-4697 BS Level FS Elev
101'

TP₁ 0.22 101.22 10.82 90.40

TP₂ 2.71 93.11 5.97 87.14

TP₃ 7.66 94.80 2.17 92.63 Grd Elev

10.59 18.96

101.00 10.59

8.37 8.37

92.63

Hernando Co June 30, 1970

Owner - DuMac Utilities Inc.

B.M. - common corner of
sections - 10 - 11 - 15 - 14

T.22 S., R. 19 E. Elev 101'

warm, partly cloudy morning

Sam - Level

Mark - Rod

Location - T22S, R19E, Sec 16, SW 1/4, SW 1/4 (d, c)

Well located in locked
pumphouse - Reading
taken at ground level
at SW corner of pump-
house —

W-10352 BS Level FS Elev
BM 39.44
TP, 5.40 44.84 0.89 43.95 Grd.

Henando Co. June 30, 1947

Owner - Deltona Corp.

BM. - Established
by Spring Hill Engineers
Elev. 39.44

Hot - Partly cloudy afternoon

Sam - Level

Mark - Red

Location - T23S, R17E, Sec-33

NW $\frac{1}{4}$ of NE $\frac{1}{4}$ (a, b)

W-5486 BS LEVEL FS ELEV

BM 25.46

TP₁ 5.17 30.63 3.31 27.32

TP₂ 6.94 34.26 5.44 28.82

TP₃ 6.98 35.80 0.47 35.33 Ground

TP₄ 19.09 9.22

Hernando Co. June 30, 1970

Owner - Weekiwachee Woodlands

BM - BM 72A; Elev. 25.46

Hot, Partly cloudy, afternoon.

Sam - Rod

Mark - Level

Location - T23S, R17E, Sec 15
SW $\frac{1}{4}$ of NW $\frac{1}{4}$ (G, a)

Well located in locked
pump house. Elevation taken
at ground level.

W-8040 BS Level FS Elev
33.41

TP, 2.85 36.26 4.65 31.61 Grd.

Hernando Co. June 30, 1970

Owner - Deltona Corp

BM. - Established by
Spring Hill Engineers
Elev. - 33.41'

Hot Partly Cloudy Afternoon

Sam - Level

Mark - Rod

Location - T3S-R17E-Sec 28
SE of NW4 (da)

NoLead
Quarry

BS

LEVEL FS

ELEV

BM

76'

TP₁ 3.16 79.16 3.53 75.63TP₂ 7.06 82.69 2.36 80.33TP₃ 3.79 84.12 0.92 83.20TP₄ 8.26 91.46 0.36 91.10TP₅ 8.96 100.06 3.02 97.04TP₆ 5.72 102.76 4.77 97.99TP₇ 0.31 98.30 6.52 91.78TP₈ 2.70 94.48 0.54 93.94TP₉ 6.43 100.37 2.52 97.85TP₁₀ 5.34 103.19 5.04 98.15Top of
Rock

51.73

29.58

Pasco Co.

July 1, 1970

BM - Topo Rd. Elev. 76'

Hot, Clear, afternoon

Sam - Rod

Mark - Level

Location - T23S - R21E, sec 26,
NW 1/4 of SE 1/4 (adj)Elevation taken at top of
rock.

98.15

Brooksville
Quarry

BS LEVEL FS ELEV

BM

101'

TP₁ 8.51 109.51 0.56 108.95TP₂ 10.03 118.98 2.54 116.74TP₃ 2.91 119.65 6.33 113.32TP₄ 2.96 116.28 3.90 112.38TP₅ 5.54 117.92 4.50 113.42TP₆ 5.00 118.42 3.12 115.30 TBMTP₇ 2.25 117.55 4.83 ~~112.42~~ 112.72TP₈ 37.20 29.08 88.47TP₉ 4.83 117.55 2.81 114.74TP₁₀ 11.46 6.63 121.37 0.70 120.37TP₁₁ 0.70 121.37 0.87 120.50TP₁₂ 10.07 130.57 0.27 130.30TP₁₂ 10.76 141.06 0.62 140.44

11.11 151.55 0.05 151.50

10.76 162.26 0.63 161.63

54.86 5.95 162.63

162.33 High pt.

Hernando Co.

July 7, 1970

Elevations of Brooksville Quarry

BM - Topo RR intersection

Elev - 101'

Hot, partly cloudy at term. noon.

Sam - Red

Mark - Level

Location - T21S, R18E, Sec 26,

NW 1/4 of NE 1/4, (a, b)

Top of
Rock

BS Level FS Elev
120'

Hernando Co. July 9, 1970
Elevations of

TP₁ 5.64 125.64 0.97 124.69

TP₂ 9.72 134.39 0.08 134.31

TP₃ 11.70 146.01 0.16 145.85

TP₄ 9.59 155.44 0.25 155.19

TP₅ 8.67 163.86 4.17 159.69

TP₆ 4.49 164.18 9.69 ~~155.49~~

49.81

15.32

154.49

Top of
Rock

BM - Topo road intersection
elevation Elev - 120'

Hot partly cloudy morning

Sam - Level
Mark - Rod

Location - T 21 S,
R 19 E, Sec 17, SW 1/4
of SE 1/4 (cd)

McDonald
Garry

BS LEVEL FS ELEV

BM

122'

TP₁ 4.99 126.99 0.86 126.13

TP₂ 6.77 132.90 0.69 132.21

TP₃ 6.98 139.19 10.22 128.97

TP₄ 0.09 129.06 11.84 117.22

TP₅ 0.18 117.40 9.76 107.64

TP₆ 6.16 113.80 3.60 110.20

TP₇ 1.75 111.95 0.77 111.18

TP₈ 10.32 121.50 0.15 121.35

TP₉ 7.65 129.00 0.20 128.80

TP₁₀ 5.21 134.01 0.76 133.25

TP₁₁ 5.01 138.26 7.97 130.29 Top

TP₁₂ 7.97 138.26 11.68 126.58

TP₁₃ 0.20 126.78 11.79 114.99

TP₁₄ 0.36 115.35 11.98 103.37

TP₁₅ 0.28 103.65 8.59 95.06 Bottom

63.92

90.86

Hernando Co July 9, 1970

Elevations of top and

bottom of rock section

BM - Top road elevation 122'

Hot, partly cloudy morning

Sun - Red

Mark - Level

Location - T22S, R20E, Sec 21

SE of NE (d.b)

Camp	BS	LEVEL	FS	ELEV	
Q. murray				123'	Hernando Co July 10, 1970
BM					Elevations of Rock Sections
TP ₁	0.03	123.03	4.42	118.61	BM - Top RR intersection
TP ₂	7.44	126.05	0.80	125.25	Elev. - 123'
TP ₃	8.96	134.21	0.49	133.72	
TP ₄	8.08	141.80	9.92	131.88	Top N Hot, Partly cloudy morning
TP ₅	9.92	141.80	0.56	141.24	Sam - Red
TP ₆	11.85	153.09	10.51	142.58	Mark - Level
TP ₇	10.84	153.42	0.47	152.95	Location N - T22S-219E-sec 8-NW 1/4 SW 1/4
TP ₈	7.97	160.92	7.24	153.68	(a/c)
TP ₉	65.09		34.41	142.58	
TP ₁₀	2.21	144.79	3.30	141.49	
				39.80	
				101.69	
TP ₁₁	0.81	102.50	9.57	92.93	
TP ₁₂	0.43	93.36	2.78	90.58	BOTS
TP ₁₃	2.78	93.36	11.16	82.20	
TP ₁₄	3.88	86.08	5.05	81.03	BOT N
					TOP Low

W-8318 BS Level FS Elev
85' BM

TP ₁	2.10	87.10	8.77	78.33
TP ₂	4.29	82.62	6.18	76.44
TP ₃	2.93	79.37	3.99	75.38
TP ₄	7.26	82.64	5.90	76.74
TP ₅	9.65	86.39	0.32	86.07
TP ₆	7.47	93.54	4.28	89.26 Grd
	33.70		29.44	3.55 89.99 Casing

Pasco Co.

July 13, 1970

Owner - Norris Cattle Co

BM. Topo road intersection


Elev 85'

Hot, partly cloudy morning

Sam - Level

Mark - Rod

Location - T24S-R18E-Sc. 35-SW 1/4 NE (C. 6)

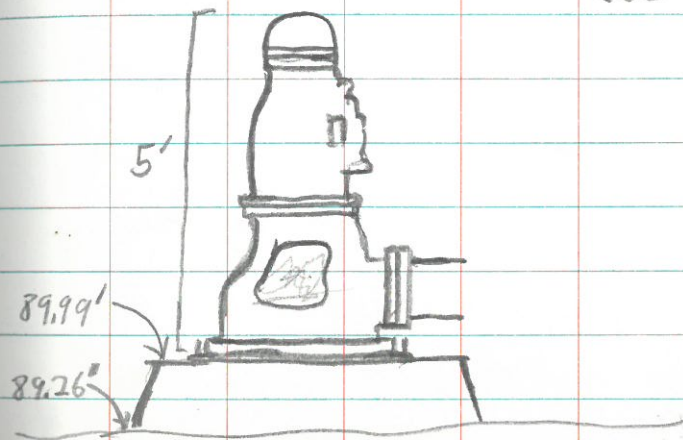

W-7801 BS LEVEL FS ELEV

BM

82'

TP₁ 3.31 85.31 4.13 81.18

TP₂ 2.95 84.13 4.88 79.25

TP₃ 4.43 83.68 5.23 78.45

TP₄ 4.04 82.49 5.61 76.88

TP₅ 4.84 81.72 5.32 76.40

TP₆ 4.80 81.20 5.14 76.06

TP₇ 5.53 81.59 3.68 77.91 casing

29.90 3.93 77.66 Ground

4.09

Pasco Co. July 13, 1970

Owner - Fla. Forest Service

BM - Topo Rd. Elev. 82'


Hot, partly cloudy afternoon

Sam - Rod

Mark - Level

Location - T23S-R22E-NW 1/4 SW 1/4

(a,c)

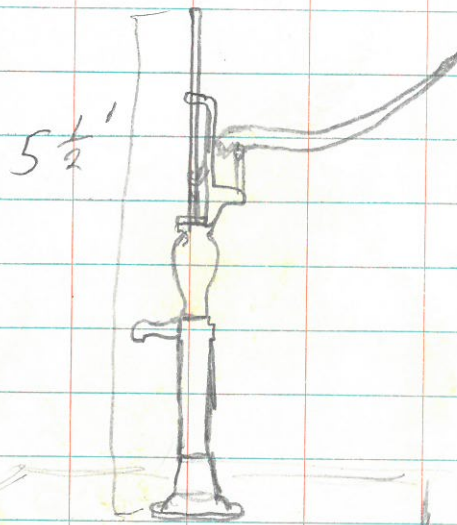

W-8840 BS Level FS Elev

96.273 BM.

TP₁ 6.36 102.63 0.03 102.60

TP₂ 11.83 114.43 0.24 114.19

TP₃ 11.99 126.18 0.22 125.96

TP₄ 8.11 134.07 10.52 123.55

TP₅ 1.67 105.22 10.79 114.43

TP₆ 0.62 115.05 5.62 109.43

TP₇ 0.55 109.98 11.93 98.05

TP₈ 0.42 98.47 11.37 87.10

TP₉ 2.63 89.73 6.83 82.90

TP₁₀ 5.40 88.30 7.24 81.06

TP₁₁ 0.10 81.16 4.69 76.47 Casing

49.68 5.22 75.94 Grd.

19.80

Pasco Co. July 13, 1970

Owner - Lake Trailer Park

BM - Established by USC&

G.S., Q 56, 1934


Elev. 96.273

Sam - Level

Mark - Rod

Hot partly cloudy
afternoon

Location T24S-R21E-Sec15-NE1/4 of NW1/4 (6a)

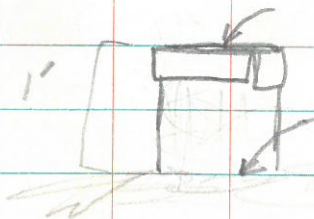

W-5865 BS Level FS Elev
101.00 B.M.

TP₁ 5.44 106.44 0.07 106.37

TP₂ 9.87 116.24 3.34 112.90

TP₃ 5.12 118.02 5.67 112.35

TP₄ 7.06 119.41 1.87 117.54

TP₅ 8.49 126.03 5.39 120.64

TP₆ 3.16 123.80 2.10 121.70 Casing

39.14 3.14 120.66 Grd.

20.70

Pasco Co

July 14, 1970

Owner - D. E. Cannon

B.M. Topo road inter-
section


Elev. 101.00

Hot partly cloudy afternoon

Sam - Level

Mark Rod

Location T255-R20E-Sec 11-SE 1/4 of SE 1/4
(d,d)

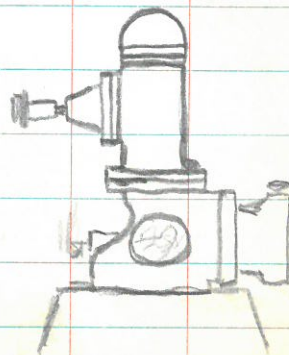

W-3284	BS	Level	FS	Elev	Passco Co.	July 14, 1970	
BM				87'	Owner - Allan Real Estate		
TP ₁	3.42	90.42	2.97	87.45	BM - T 265, R 21E, Sec 2, Center		
TP ₂	4.60	92.05	0.57	91.48	of Section, Elev. 87'.		
TP ₃	5.56	97.04	4.13	92.91			
TP ₄	2.12	95.03	10.18	84.85	Well #1	Hot, Partly cloudy, afternoon.	
TP ₅	3.39	88.24	4.30	83.94	Ground	Sam - Red	
	19.09		22.15	3.23	85.01	Casing	Mark - Level
		3.06				Well #2	Location - T265-R21E-Sec 3-SE 1/4 of SE 1/4
			6.99	81.25	Ground		(d,d)

Well #1

Well #2

under ground



w-3965 BS Level FS Elev
 BM 232'
 TP₁ 4.98 236.98 4.36 232.62
 TP₂ 4.17 236.79 8.01 228.78 Ground
 9.15 12.37

3.22

Pasco Co.

July 14, 1970

Owner - St. Joseph School

BM - Common to Sec. of Secs. 23 & 26

T-24S-R20E Elevation - 232'

Hot, partly cloudy morning

Sam - Red

Mark - Level

Location - T24S-R20E-SE 1/4 of SW 1/4 (d, c)

Submersible pump.

W-3404 B5 Level FS Elev
66' BM

TP₁ 5.16 71.16 3.62 67.54

TP₂ 3.03 70.57 3.52 67.05 Grd

8.19

7.14

3.36

67.21

Casing
(Concrete
Floor)

105

Pasco Co. July 14, 1970

Owner - I. A. Krusen

BM. Topo road inter-
section


Elev. 66'

Hot, Partly Cloudy afternoon

Sam - Level

Mark - Rod

Location - T26S-R20E-Sec 35-SW 1/4 of SW 1/4
(dd)

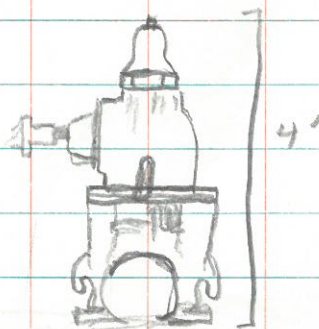

W-10296	BS	LEVEL	FS	ELEV
BM				107.10'
TP ₁	10.45	117.55	0.00	117.55
TP ₂	10.90	128.45	4.43	124.02
TP ₃	0.80	124.82	11.18	113.64
TP ₄	0.10	113.74	2.70	111.04
TP ₅	6.53	117.57	0.28	117.29 Casing
	28.78		18.59 1.16	116.41 Ground

10.19

Hernando Co. July 15, 1970

Owner - L. A. Brady

BM - U. S. G. S. BM., 36 ERS, 1952


TT, Elev. - 107.10'

Hot, Cloudy afternoon

Sam - Rod

Mark - Level

Location - T235 - R20E - Sec 1 - NE 1/4 of NW 1/4
(b.a)

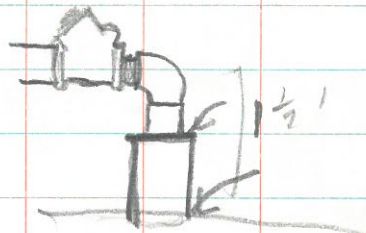

W-8188 BS Level FS Elev
103 B.M.

TP ₁	2.10	105.10	11.19	93.91
TP ₂	1.04	94.95	9.02	85.93
TP ₃	2.24	88.17	10.79	77.38
TP ₄	0.36	77.74	11.17	66.57
TP ₅	10.21	76.78	0.10	76.68
TP ₆	10.08	86.76	10.25	76.51
TP ₇	1.78	77.29	3.85	73.44
TP ₈	<u>2.40</u>	<u>75.84</u>	<u>2.32</u>	<u>73.52</u> Ground
	30.21		58.69	74.52 →

28.48 74.72

Hernando Co. July 15, 1970
Owner - Thayer-Davis
B.M. SRD, Elev. given
on Topo
Elev. 103'

Hot Partly cloudy afternoon

Sam - Level
Mark-Rod

Location - T22S-R21E -
Sec 32 - SW 1/4 of SW 1/4 (c, c)

Pump located in concrete
block house

W-8021 BS LEVEL FS ELEV
BM 82'

TP₁ 3.72 85.72 10.66 75.06

TP₂ 6.11 81.17 1.20 79.97

TP₃ 1.03 81.00 8.10 72.90

TP₄ 4.22 77.12 3.91 73.21

TP₅ 6.44 79.65 3.33 76.32

21.52

5.68

27.20
4.09

Casing

Ground

Hernando Co. July 16, 1970

Owner - Peaches of Fla, Inc.

BM - Topo Rd Elev - 82'


Warm, Clear morning

Sam - Red

Mark - Level

Location - T22S-R20E-Sec 33

SW $\frac{1}{4}$ of SW $\frac{1}{4}$ (cf)

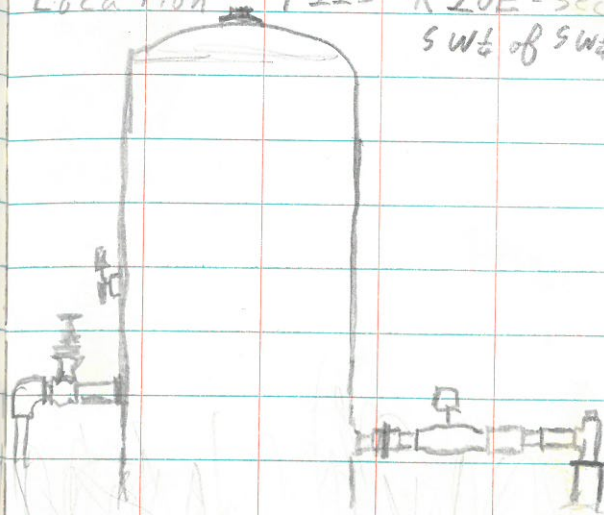

W-3675 BS Level FS Elev
65 BM

	TP ₁	TP ₂	TP ₃	TP ₄	TP ₅	
	11.77	76.77	2.76	74.01		
	3.33	77.34	5.54	71.80		
	3.53	75.33	7.19	68.14		
	10.09	78.23	1.12	77.11		
	9.91	87.02	3.15	83.87	Casing	
	38.63		4.43	82.59	Grd	
		18.87				


Hernando Co. July 16, 1970
Owner - Western Reserve
Properties Inc.

BM - SR D, Elev. given
on Topo

Elev. 65'

Hot, Partly Cloudy afternoon
Sam - Level
Mark - Rod

Location - T235-T21E-Sec 2
SE 1/4 of SW 1/4 (c.d)

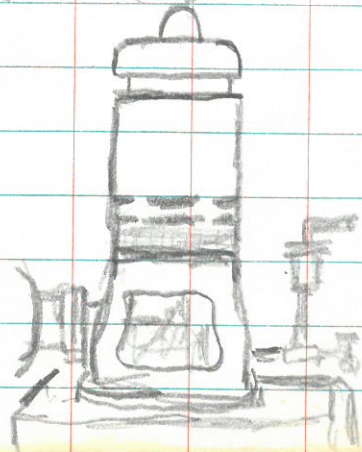

W-4410 BS Level FS Elev
65 BM

TP ₁	11.77	76.77	2.76	74.01	
TP ₂	3.33	77.34	5.54	71.80	
TP ₃	3.53	75.33	7.19	68.14	
TP ₄	10.09	78.23	1.12	77.11	
TP ₅	<u>9.91</u>	87.02	2.70	84.32	Casing
	38.63		^{19.31} 3.27	83.75	Grd
		19.32			

Hernando Co. July 16, 1970
Owner - Western Reserve
Properties Inc.

BM - SAD Elev. given
on Topo.
Elev 65'

Hot Partly Cloudy afternoon
Sam - Level
Mark - Rod

Location T235-R21E-Sec2
SE 1/4 of SW 1/4 (Gd)

2 1/2



Lansing
Quarry

BS LEVEL FS ELEV

BM

87'

TP₁ 6.63 93.63 0.22 93.41

TP₂ 9.15 102.56 0.09 102.47

TP₃ 11.55 114.02 0.95 113.07

TP₄ 3.36 116.43 0.48 115.95

TP₅ 9.70 125.65 4.62 121.03

TP₆ 4.29 125.32 0.55 124.77

TP₇ 11.08 135.85 0.30 135.55

TP₈ 11.27 146.82 1.55 145.27

TP₉ 11.85 157.12 0.00 157.12

78.88 8.76

70.12

TBM 115.95'

TP₁ 0.39 116.34 11.82 104.52

TP₂ 0.13 104.65 11.86 92.79

TP₃ 1.04 93.83 11.79 82.04

TP₄ 0.00 82.04 11.70 70.34

TP₅ 0.98 69.36 10.52 58.84

2.54 57.69 60.80

43

55.15

60.80

Base

Hernando Co

July 16, 1970

Elevations at Lansing

Quarry

BM - Assumed Ground elevation

from exact location of U.S.C. & G.S.

BM A41, 1933, Elev 87.25'

87' used as elev.

Sam - Rod

Mark - Level

Hot, partly cloudy afternoon

Location - T215, R19E, Sec 22

BM 0.11 105.11 105.00

TP₁ 0.07 100.03 5.15 99.96

TP₂ 3.72 92.14 11.51 88.42

MP₁ 3.90 5.50 86.64 86.74

Elev. Check on B.M.

STAV
W-2876 BS+ HI FS- ELEV

BM MP₁ 10.04 55.63
MP₂ 11.20 11.20 54.47
Casing
Ground

TP₁ 10.84 21.81 0.23 10.97

TP₂ 11.26 31.68 0.39 20.42

TP₃ 6.89 38.55 0.02 31.66

TP₄ 4.51 42.45 0.61 37.94

TP₅ 9.21 49.85 1.81 40.64

TP₆ 11.61 60.91 0.55 49.30

TP₇ 10.63 66.10 5.44 55.47

TP₈ 5.19 70.66 0.63 65.47

TP₉ 81.34 10.74 70.50 1.16 69.50 TBM

Tie in BM 0.60 123.60 10.84 123'

TP₁ 9.08 129.90 2.78 120.82

TP₂ 0.17 126.37 3.36 126.54

TP₃ 0.07 114.81 11.63 114.74

TP₄ 6.13 116.69 4.25 110.56

TP₅ 10.97 127.30 0.36 116.33

44

Hernando Co July 20, 1970

Owner - Camp Concrete Rk. Products

BM - Topo RR intersection

Elev - 123'

Sam - Red

Mark - Level


Warm, cloudy afternoon.

Location - T225-R19E - Sec 6

NW 1/4 of SE 1/4 (a,d)

TP₁ 4.34 129.22 2.42 124.88

MP₁ 31.36 4.59 124.63
29.39 124.97
1.97

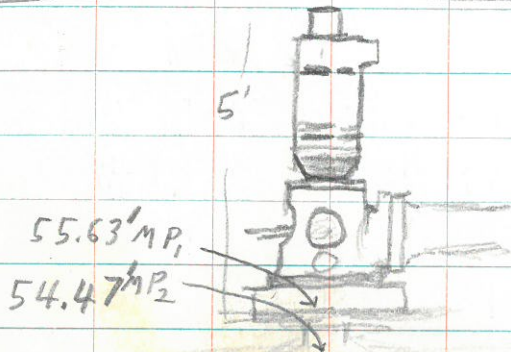

STAV W-4158	BS	HI	FS	ELEV
BM	3.03	71.03		68'
TP ₁	5.62	68.62	8.03	63.00
TP ₂	5.05	70.92	2.75	65.87
MP	<u>13.70</u>		4.83	66.09 Ground
	1.91		<u>15.61</u>	

Hernando Co July 20, 1970

Owner - State Rd. Dept.

BM - Topo rd. intersection

elev - 68'

Sam - Rod

Mark - Level

Warm, Cloudy afternoon


Location - T23S-R18E-Sec 13

NE 1/4 of SE 1/4 (Q, d)

Well located in locked
pump house.

Sta. V	W-6627	BS	HI	FS	Elev.
BM	2.46	76.46			74.00'
TP ₁	4.21	75.18	5.49		70.97
TP ₂	4.12	75.06	4.24		70.94
TP ₃	4.65	75.31	4.40		70.66
MP ₁	15.44		3.88		71.43 Casing
MP ₂		18.01	5.48		69.83 Grd.
	2.57				

Hernando Co July 21, 1970
 Owner - SW. Water Management
 BM. Topo road intersection
 Elev. 74'
 Warm Partly Cloudy Morning
 Sam - Level
 Mark - Rod
 Location - T23S-R19E-Sec 19
 SW 1/4 of NE 1/4 (C, L)

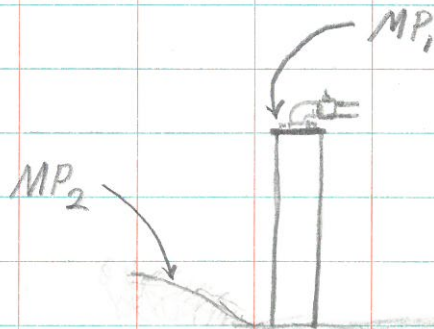

W-10301 BS HI FS ELEV

BM 1.50 46.50 45.00'

TP₁ 2.65 40.65 8.45 38.00

TP₂ 0.09 31.57 9.17 31.48

TP₃ 0.22 19.97 11.82 19.75

TP₄ 7.17 21.79 5.35 14.62

MP₁ 11.63 6.26 15.53

MP₂ 41.05 7.04 14.75

29.42

15.58

Casing

14.80

Ground

Hernando Co. July 22, 1970

Owner - Weckiwachee Water Co

BM - US C+GS. BM - Robins, 1934.

Elev. given on topo map - 45.00'

Cool, cloudy morning

Sam - Red

Mark - Level

Location - T22S-R17E-Sec 27

SW 1/4 of SW 1/4 (c, c)

Diagram on second
page following

W-8699	BS	HI	FS	ELEV	
BM	7.04	21.79		14.75	
MP ₁			2.48	19.31	Casing
MP ₂			4.36	17.43	Ground

4.56

Hernanda Co. July 22, 1970

Dancer-Wickiwassee Water Co.

BM - W-10301


Cool, cloudy morning

Sun - Red

Mark - Level

Location - T22S-R17E-Sec 27

SW 1/4 of SW 1/4 (C, C)

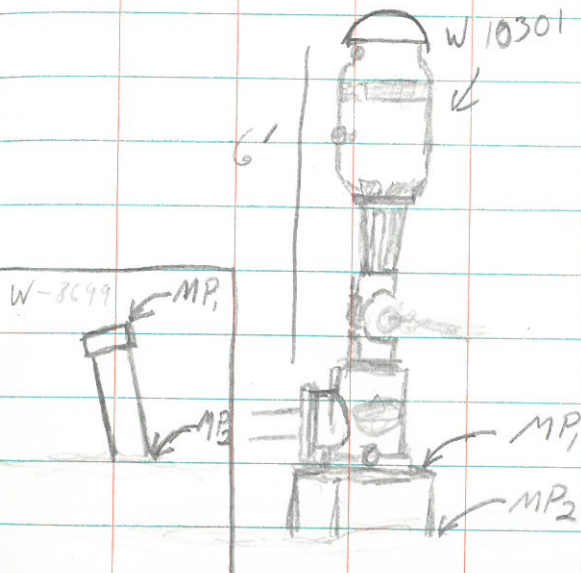

W-8427 BS HI FS ELEV

BM 4.36 21.79 17.43

MP₁ 3.64 18.15 Casing

MP₂ 4.29 17.50 Ground

+ .72

Hernando Co July 22, 1970

Owner - Weckiwachee Water Co

BM - W-8699


Cool, cloudy morning.

Sam - Rod

Mark - Level

Location - T22S-R17E-Sec 27

SW $\frac{1}{4}$ of SW $\frac{1}{4}$ (C,C)

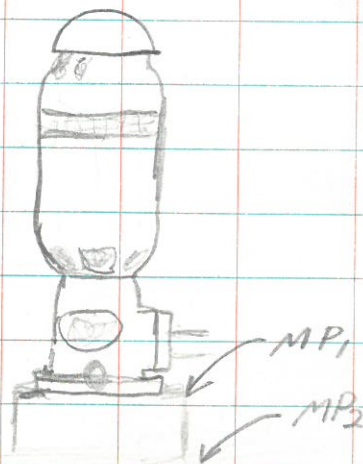

W-7664	BS	HI	FS	Elev
BM	6.05	12.05	↓	6.00'
TP ₁	4.25	11.69	4.61	7.44
TP ₂	4.83	12.46	4.06	7.63
TP ₃	4.78	13.32	3.92	8.54
M.P. ₁	19.91		6.11	7.21 Grd.
			18.70	

1.21

Hernando Co., July 22, 1970
 Owner - Weeki Wachee River
 Estates (AW Care)
 BM. USGS 1952, 48 ERS TT
 Elev. 6'

Hot Partly Cloudy Morning
 Sam - Level
 Mark - Rod

Location - T22S-R17E-Sec 28
 SE $\frac{1}{4}$ of NW $\frac{1}{4}$ (d, a)
 Well abandoned. Elev. run
 to ground level.

W-4830 BS HI FS ELEV

BM 1.20 144.49 143.290

TP₁ 0.00 133.01 11.48 133.01

TP₂ 7.71 131.55 9.17 123.84

TP₃ 5.15 131.75 4.95 126.60

MP₁ 14.06 4.04 127.71 Casing

MP₂ 29.64 6.88 124.87 Ground

15.58

Hernando Co July 22, 1970

Owner - Dairy Service Corp.

BM - Coastal City Engineers BM

N. Bolt on rim of fire hydrant at intersection of Old Dale City Rd.

+ Main St. Elev - 143.290

Hot, partly cloudy afternoon


Sun - Red

Mark - Level

Location - T22S-R19E-Sec 27

NE $\frac{1}{4}$ of NE $\frac{1}{4}$ (b, b)

Well located on concrete platform
elevations taken of casing + ground
level by platform.

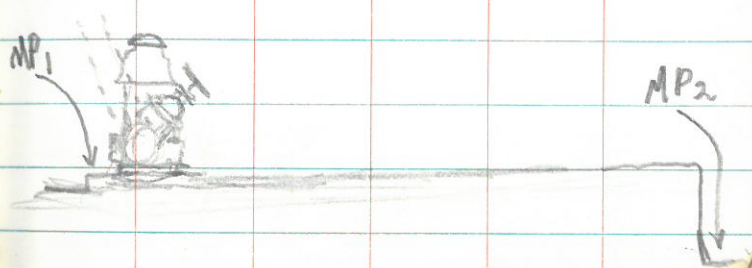

W-6556 BS HI FS Elev

BM 0.43 202.43 ↓ 202.00'

TP₁ 0.21 191.02 11.62 190.81

TP₂ 0.12 189.22 11.92 189.10

TP₃ 1.12 178.58 11.76 177.46

TP₄ 0.37 167.20 11.75 166.83

TP₅ 0.29 155.59 11.90 155.30

TP₆ 0.73 144.62 11.70 143.89

TP₇ 0.98 134.75 10.85 133.77

TP₈ 0.52 126.15 9.12 125.63

TP₉ 4.17 121.19 9.13 117.02 107.75

MP₁ 8.94 103.19 3.44 117.75 ↑ Casing

MP₂ 4.59 116.60 106.60 Grd.

94.25

Hernando Co. July 22, 1970

Owner - Marg Boyd Corp.

BM. Topo Road Intersection

Elev. 202.00'


Hot Cloudy afternoon

Sam - Level

Mark - Rod

Location - T23S-R20E-sec17

SE $\frac{1}{4}$ of SE $\frac{1}{4}$ (d.d)

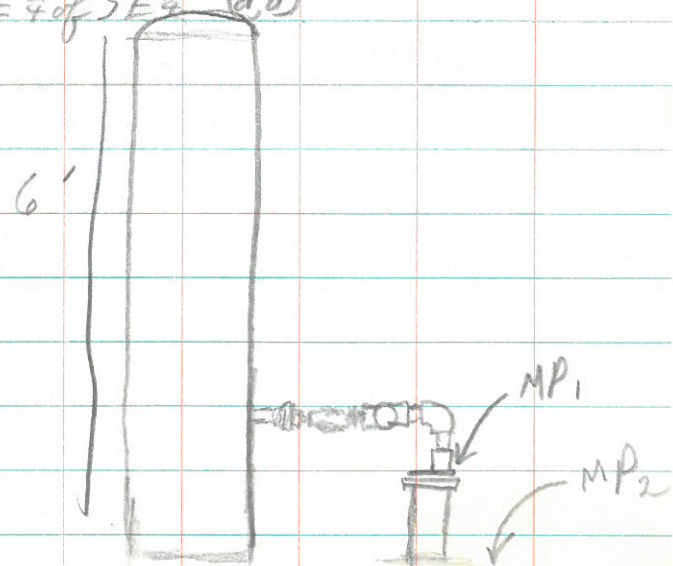

W-6562	BS	HI	FS	ELEV
BM	6.96	94.99		88.030
TP ₁	7.01	100.75	1.25	93.74
TP ₂	7.03	105.67	2.11	98.64
TP ₃	6.02	105.98	5.71	99.96
MP ₁	<u>27.02</u> 13.79		<u>3.72</u>	102.26 Casing
MP ₂	14.23	12.79	4.31	101.67 Ground

14.23

88.030

~~4.22~~

102.26

Hernando Co July 22, 1970

Owner - George McDonald

BM - SRD South, USC & GS run in,

Elev. - 88.030


Hot, partly cloudy afternoon.

Sam - Red.

Mark - Level

Location - T22S - R19E - Sec 33

NW $\frac{1}{4}$ of NE $\frac{1}{4}$ (a, b)

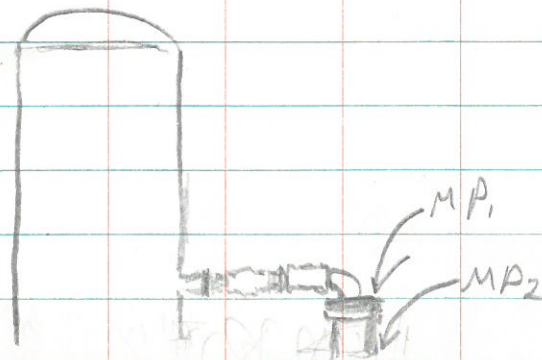

W-5694	BS	HI	FS	Elev	
BM	6.78	88.78	↓	82.00	'
TP ₁	3.60	89.31	3.07	85.71	
TP ₂	11.83	98.87	2.27	87.04	
TP ₃	11.36	110.09	0.14	98.73	
TP ₄	7.60	117.31	0.38	109.71	
TP ₅	<u>5.95</u>	121.60	1.76	115.55	118.35
MP ₁	47.12		<u>3.15</u>	118.45	Casting
MP ₂		10.77	<u>3.86</u>	117.77	117.84 Grd

36.35

Hernando Co July 23, 1970

Owner - Elmore Wennicke

BM- T23S, R20E, Common N
Corner of Secs. 4 & 3

Elev. 82.00'


Hot Partly Cloudy Morning

Sam - Level

Mark Rod

Location - T23S-R20E-Sec3

NW¹/₄ of NW¹/₄ (a, a)

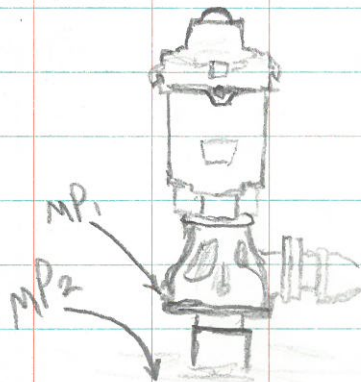

STA
W-6234 BS HI FS ELEV

BM 10.30 88.30 78.00'

TP₁ 10.52 98.68 0.14 88.16

TP₂ 11.23 109.60 0.31 98.37

TP₃ 8.37 117.84 0.13 109.47

TP₄ 5.68 116.14 7.38 110.46

TP₅ 6.33 115.65 6.82 109.32

TP₆ 10.82 126.43 0.04 115.61

MP₁ 63.25 4.34 122.09 Casing

MP₂ 19.16 5.05 121.38 Ground

44.09

Hernando Co July 24, 1970

Owner - Norris Cattle Co

BM - Topo rd. Elev. - 78'


Hot, partly cloudy, morning

Sam - Rod

Mark - Level

Location - T21S, R18E, sec 15

NW 1/4 of NE 1/4 (a, b)

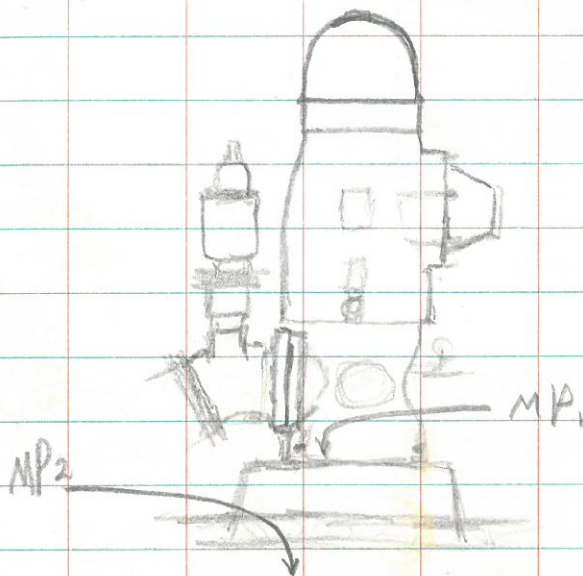

W-7674 BS HI FS Elev
BM 3.60 142.60 ↓ 139.00'
MP, 2.72 139.88 Grd.

.88

Pasco Co. July 27, 1970
Owner - Order of St. Bene-
dict of Fla.

BM. Topo road intersection
Elev 139.00'

Hot Partly cloudy afternoon
Sam - Level

Mark - Red

Location - T25S-R21E-Sec 5
NW $\frac{1}{4}$ of SW $\frac{1}{4}$ (a, c)

Well located in locked
Pump house.

W-8507 BS HI FS ELEV

BM 11.99 184.99 173.00'

TP₁ 11.95 196.84 0.10 184.89

TP₂ 7.41 204.70 0.08 196.76

TP₃ 2.47 197.99 8.65 195.52

TP₄ 5.41 196.69 6.71 191.28

MP₁ 39.23 5.13 191.56

MP₂ 20.67 5.73 190.96

18.56

Casing

Ground

Pasco Co July 27, 1970

Owner - Miller's House

BM - Topo rd. elev - 173'

Hot, partly cloudy afternoon

Sam - Red

Mark - Level

Location - T24S-R20E-Sec 35

NE 1/4 of SW 1/4 (b, c)



W 5977 BS HI FS Elev

BM 6.40 110.40 ↓ 104.00'

TP₁ 7.58 117.74 0.24 110.16

TP₂ 5.90 114.77 8.87 108.57

TP₃ 5.87 120.79 0.15 114.92

TP₄ 11.90 132.27 0.42 120.37

TP₅ 11.83 143.74 0.36 131.91

TP₆ 3.52 145.17 2.09 141.65

MP, 53.00 1.36 143.81

13.49

143.51

Cash

+ Ground

39.51

Pasco Co

July 27, 1970

Owner George Naeyaert

BM Topo Road Intersection

Elev. - 104'

Cool Cloudy Afternoon

Sam - Level

Mark Rod

Location - T25S-R20E

Sec 14 - SE $\frac{1}{4}$ of SE $\frac{1}{4}$ (d,d)



MP₁

W-10298	BS	HI	FS	ELEV
BM	0.13	158.13		158.00'
TP ₁	0.87	147.79	11.21	146.92
TP ₂	0.11	136.25	11.65	136.14
TP ₃	9.90	137.81	8.34	127.91
TP ₄	11.15	148.88	0.08	137.73
TP ₅	0.38	143.63	5.63	143.25
TP ₆	0.20	131.83	12.00	131.63
TP ₇	0.53	120.50	11.86	119.97
TP ₈	3.08	115.49	8.09	112.41
MP ₁	<u>26.35</u>		<u>10.16</u>	105.33 Casing
MP ₂		79.02	<u>10.76</u>	104.73 Ground

5267

Pasco Co. July 28, 1970

Owner - W.C. Dees

BM - T23S, R 20E & 21E, Common

Cor of Secs. 24, 19, 25, & 30.

Elev - 158'


Hot, clear morning.

Sum - Rod

Mark - Level

Location - T23S-R21E-Sec. 19

SW 1/4 of NW 1/4 (c, a)

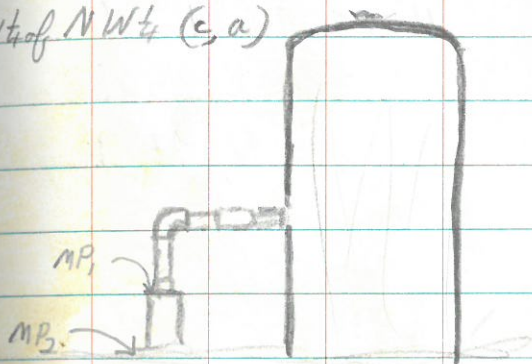

WS 282	BS	HI	FS	Elev
BM	0.33	127.33	↓	127.00'
TP ₁	1.04	116.47	11.90	115.43
TP ₂	6.98	113.00	10.45	106.02
TP ₃	8.46	121.41	0.05	112.95
TP ₄	11.38	129.78	3.01	118.40
TP ₅	9.14	138.82	0.10	129.68
TP ₆	0.96	139.69	0.09	138.73
TP ₇	0.23	128.15	11.77	129.92
TP ₈	0.48	116.63	12.00	116.15
TP ₉	1.51	106.99	11.15	105.48
TP ₁₀	1.56	97.07	11.42	95.51
TP ₁₁	10.23	98.11	9.19	87.89
TP ₁₂	9.12	106.81	0.42	97.69
TP ₁₃	11.40	117.93	0.28	106.53
TP ₁₄	<u>8.24</u>	122.08	4.09	113.84
MP ₁	81.06		<u>3.29</u>	118.79 Grd
			89.27	

Pasco Co. July 28, 1970
 Owner - N.S. Burns & Sons
 BM Topo Road Intersection
 Elev. 127.00'
 Hot Partly Cloudy
 Afternoon
 Same Level
 Mark Rod
 Location - T25S-R21E-sec 8
 SE 1/4 of NE 1/4 (d, b)

Well located in locked
 pumphouse.

W-6504 BS HI FS ELEV

BM 10.44 92.32 81.88'

TP₁ 11.69 103.43 0.58 91.74

TP₂ 11.55 114.94 0.04 103.39

TP₃ 10.63 123.92 1.65 113.29

TP₄ 11.77 135.39 0.30 123.62

TP₅ 7.87 142.72 0.54 134.85

TP₆ 4.93 141.74 5.91 136.81

MP₁ 6.88 4.81 136.93 Casing

MP₂ 13.43 4.97 136.77 Ground

55.05

Pasco Co

July 29, 1970

Owner - Pasco Co. Schools

BM - TBM Elev - 81.88'

Hot, partly cloudy afternoon

Sun - Red

Mark - Level

Location - T24S-R21E - Sec 33

NE 1/4 of SE 1/4 (Q, d)



W-5092 BS HI FS Elev

BM 0.12 97.08 ↓ 96.962

TP, 8.91 102.23 3.76 93.32

MP, 3.90 ~~98.33~~ Casing

MP₂ 4.05 ~~98.18~~

Elev Check

BM. 3.04 102.88 ↓ 99.792

MP, 4.83 98.05 Casing

MP₂ 4.98 97.90 Grd

1.74

Pasco Co July 29, 1970

Owner - Bank of Zephyrhills

BM - USC & GS, T106

1943 Elev. - 96.962

Hot Partly Cloudy


Afternoon

Sam-Level

Mark - Rod

Location - T26S-R21E-Sec 11

NW 1/4 of SE 1/4 (and)

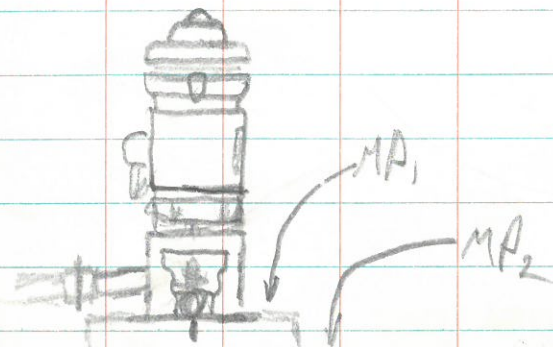

W-3512 BS HI FS ELEV

BM 5.28 71.55 66.27

TP, 5.23 74.89 1.89 69.66

MP, 10.51 3.49 71.40 Casing

MP₂ 5.39 4.73 70.16 Ground

5.13

Pasco Co July 29, 1970

Owner - State Rd. Dept.

BM - TBM 66.27'


Hot, partly cloudy afternoon

Sam - Rod

Mark - Level

Location - T26S-R21E-Sec 27

NE $\frac{1}{4}$ of NW $\frac{1}{4}$ (Lga)

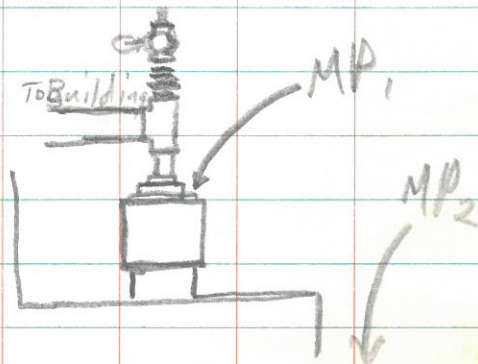

5.30

Well located in locked
pump house

W-5271

BS

HI

FS

ELEV

BM

5.36

12.61

7.25'

TP₁

5.25

14.76

3.10

9.51

TP₂

8.01

19.19

3.58

11.18

TP₃

4.62

22.01

1.80

17.39

TP₄

4.93

23.20

3.74

18.27

MP₁

28.17

5.99

17.21'

Ground

18.21

9.96

Pasco Co.

July 30, 1970

Owner - Gulf Terrace Land Co.

BM - TBM # 26 SRD?

Elev. - 7.25'

Hot, partly cloudy afternoon.

Sam - Red

Mark - Level

Location - T24S-R16E-sec34

SE $\frac{1}{4}$ of SW $\frac{1}{4}$ (d/c)Well located in locked
pump house. Elev taken at
ground level.

17.81

NW of NE $\frac{1}{4}$ (a, b)

well located in locked
pump house.

W-5089 ✓ BS HI FS ELEV

BM 9.52 33.52 24.00"

TP₁ 0.16 25.17 8.51 25.01

TP₂ 9.93 24.65 10.45 14.72

TP₃ 7.86 30.22 2.29 22.36

TP₄ 4.91 31.78 3.35 26.87

MP₁ 32.36 4.19 27.59 Concrete Casing

MP₂ 4.65 27.13 Ground

3.59

32.36
28.74
3.59

26.79

24.00
2.59
27.59

Pasco Co. August 4, 1970

Owner - J. E. Green

BM - T25S-R16E-Sec 33 Center
of Sec 33 Elev. - 24'


Hot, partly cloudy afternoon.

Sam-Rod

Mark-Level

Location - T25S-R16E-Sec 33


SE 1/4 of SW 1/4 (c, d)

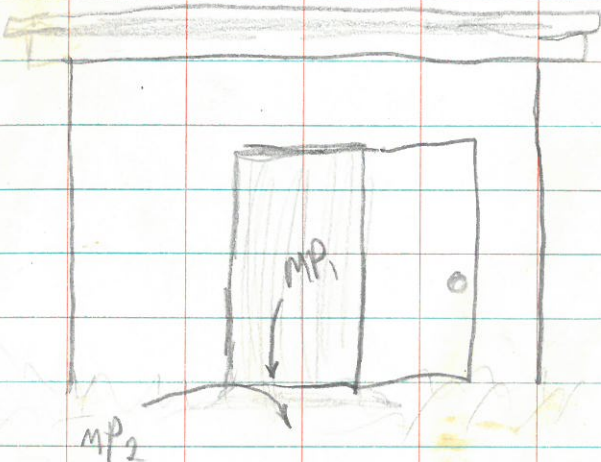

W-5272 ^V W-7648	BS	HL	FS	Elev
BM	4.05	66.22	↓	62.175
TP ₁	1.91	60.71	7.42	58.80
TP ₂	1.28	53.36	8.63	52.08
TP ₃	0.91	45.09	9.18	44.18
TP ₄	4.58	45.11	4.56	40.53
TP ₅	4.38	45.10	4.39	40.72
TP ₆	1.42	40.37	6.15	38.95
TP ₇	2.90	34.97	8.30	32.07
TP ₈	3.57	32.21	6.33	28.64
TP ₉	4.40	31.21	5.40	26.81
TP ₁₀	4.69	31.48	4.42	26.79
MP ₁	34.09		4.27	27.21 Casing N. Small pump
MP ₂		69.05	4.12	27.36 Casing N. Large pump
MP ₃		34.96	21.66	26.82 Grd N
	4.37	31.58	↓	27.21 correct
MP ₄			4.05	27.53 Casing S
MP ₅			4.18	27.40 Grd S

68

Pasco Aug. 5, 1970
 Owner Grove Park Homes
 Inc. (reset)
 BM USC & GS, 1959 (1934,
 NO 6, Elev. 62.175'
 Hot, Partly Cloudy Morning
 Sam - Level
 Mark - Red
 Location - T2CS-R1GE - Sec 19
 SE $\frac{1}{4}$ of SE $\frac{1}{4}$ (d,d) S.
 N.

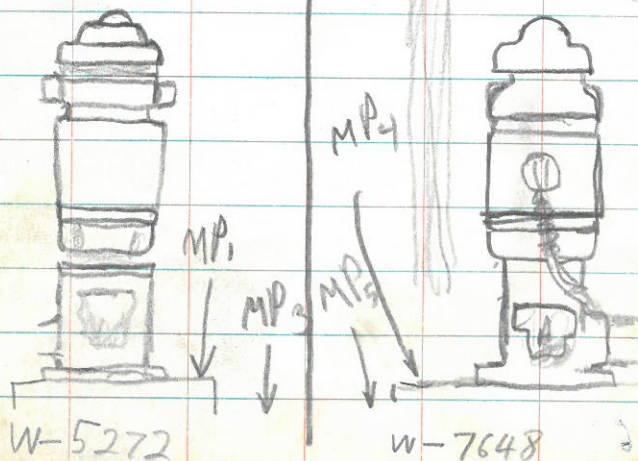

STA ✓
W-8863 BS HI FS ELEV
BM 3.98 21.05 17.07
MP, 5.64 15.41 Ground

Pasco Co. August 6, 1970
Owner - Community Methodist Church

BM - SRD TBM #1 Elev - 17.07

Hot, cloudy morning

Sun - Red

Mark - Level

Location - T26S-R16E-Sec 19


SW 1/4 of SE 1/4 (Gd)

Well located in locked
pump house.

^V
 W-7651 BS HI FS ELEV
 BM 5.64 21.05 15.41
 TP₁ 5.33 22.60 3.78 17.27
 TP₂ 2.92 21.75 3.77 18.83
 TP₃ 5.16 22.75 4.16 17.59
 TP₃ 5.31 26.58 1.48 21.27
 MP₁ 24.36 5.41 21.17 Ground
 MP₂ 18.60 4.16 22.42 Casing

5.76

Pasco Co August 6, 1970
 Owner - Colonial Manor S/D
 BM - W-8863
 Hot, cloudy morning
 Sam - Rod
 Mark - Level
 Location - T265-R16E-Sec 19
 SW $\frac{1}{4}$ of NE $\frac{1}{4}$ (c, b)

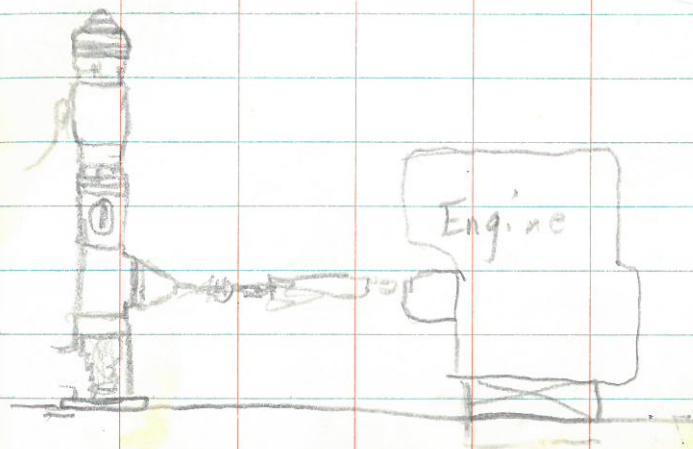

W-8488 ✓ BS HI FS Elev
 BM 3.15 20.22 ↓ 17.07'
 TP₁ 3.29 19.01 4.50 15.72
 TP₂ 8.67 21.84 5.84 13.17
 TP₃ 9.60 29.48 1.96 19.88
 24.71 1.93 27.55 Grd
 14.23

10.46

Pasco Co August 6, 1970
 Owner - B.J. Mickler
 BM. - SRD T.B.M. No. 1
 Elev. - 17.07'
 Hot Partly Cloudy Afternoon
 Sam - Level
 Mark - Rod
 Location - T26S-R16E-Sec 19
 SW $\frac{1}{4}$ of SW $\frac{1}{4}$ (C.C.)

Well located in
 locked pump house

STA	BS	HI	FS	ELEV
W-7650				
BM	5.46	16.76		11.30'
MP,			5.05	11.71' Ground

Pasco Co August 6, 1970

Owner - Tahitian Gardens Inc.

BM - Contractor's Floor Elev.

Elev. - 11.30'

Hot, partly cloudy Afternoon

Sam - Red

Mark - Level

Location - T265-R1E-Sec 30

NW 1/4 of SW 1/4 (a, c)

Well located in locked pump house.

W-8862 DS HI FS Elev

BM 1.86 21.29 ↓ 19.43

TP₁ 1.84 18.20 4.93 16.36

TP₂ 2.88 9.10 11.98 6.22

TP₃ 11.16 11.34 8.92 0.18

TP₄ 10.34 18.66 3.02 8.32

TP₅ 8.87 27.40 0.13 18.53

MP₁ 36.95 2.00 25.40 Casing

MP₂ 30.98 2.81 24.59 Grd.

597

Pasco Co. August 2, 1970

Owner - Forest Hills

BM SRD TBM #8

Elev. - 19.43


Hot Partly Cloudy Morning

Sam - Level

Mark - Rod

Location - T26S R16E

Sec 32, SW $\frac{1}{4}$ of NW $\frac{1}{4}$
(C.A.)

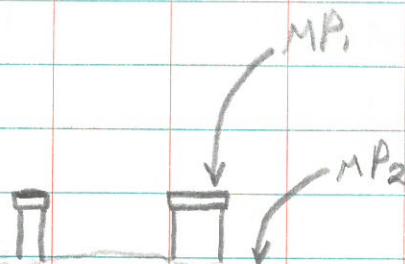

W-8509 BS	HT	FS	ELEV	
BM	3.46	14.86	11.40'	
TP ₁	6.47	17.27	4.06	10.80
TP ₂	5.80	20.36	2.71	14.56
TP ₃	5.20	22.56	3.00	17.36
TP ₄	6.15	20.92	7.79	14.77
MP ₁	27.04	7.98	12.94	Ground
		25.54		
	1.54			

Pasco Co. August 7, 1970

Owner - Holiday Apts

BM - Contractor's Floor elev
11.40'

Hot, cloudy afternoon.

Sam - Levee

Mark - Red

Location - T265, R16E

Sec 31, NW 1/4 of NE 1/4
(bp)

Well located in locked
pump house.

W-10339 BS HI FS Elev

BM 7.02 27.57 ↓ 20.55

TP, 5.09 24.19 8.47 19.10

MP, 12.11 4.21 19.98 Grd

~~MP₂~~ 12.68 3.68

MP₂ 3.28 20.91 Casing

.57

Pasco Co.

August 11, 1970

Owner - Larry Johnson

St. James Apts.

BM. Established by

Casson Engineering Co.

Intersection of Pasadena
& Old Dixie Hiway.


Elev. 20.25

Sam-Level

Mark-Rod

Location - T265-R16E-Sec 17

SE $\frac{1}{4}$ of NW $\frac{1}{4}$ (1, a)

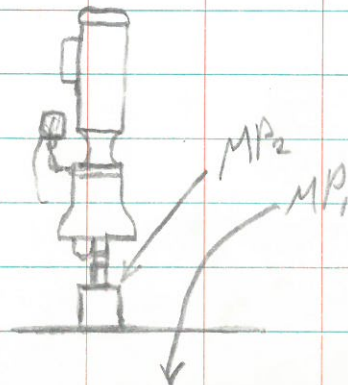

W-7802	BS	HI	FS	ELEV
BM	4.53	99.53		95.00
TP ₁	3.61	98.13	5.01	94.52
TP ₂	4.63	98.60	4.16	93.97
TP ₃	5.18	98.60	5.18	93.42
TP ₄	4.90	97.86	5.64	92.96
TP ₅	4.88	97.77	4.97	92.89
TP ₆	4.67	97.20	5.24	92.53
TP ₇	5.18	97.05	5.33	91.87
TP ₈	5.13	97.05	5.13	91.92
TP ₉	5.45	97.10	5.40	91.65
TP ₁₀	4.86	96.80	5.16	91.94
TP ₁₁	4.72	97.26	4.26	92.54
MP ₁	57.74		4.42	92.84 Concrete
MP ₂		59.90	4.74	92.52 Ground

2.16

Sumter Co. August 13, 1970

Owner - Fla. Forest Service

BM - U.S. G. S. BM, 50 ES,

1955, Elev. - 95'

Warm, partly cloudy morning.

Sun - Red

Mark - Level

Location - T23S-R23E-Sec 31

SW 1/4 of NW 1/4 (C, a)



W-5863 BS HI FS Elev

BM 10.44 127.44 ↓ 117.00'

TP 3.34 130.13 0.65 126.79

TP₂ 3.00 122.86 10.27 119.86

MP₁ 16.78 9.59 113.27 casing

MP₂ 20.51 10.24 112.62 Ground

3.73

Pasco Co. August 13, 1970

Owner - D E. Cannon

BM - Topo Road Inter
section Elev. 117.00'


Hot Cloudy Afternoon

Sam - Level

Mark - Rod

Location - T2SS-R20E

Sec-15-SE $\frac{1}{4}$ of SE $\frac{1}{4}$ (d, d)

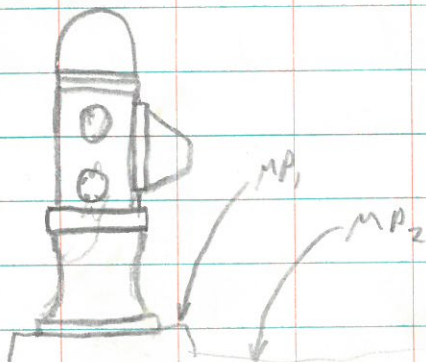

W-2160 BS HI FS ELEV

BM 5.81 123.81 118.00

TP₁ 10.32 134.13 0.00 123.81

TP₂ 7.57 141.39 0.31 133.82

TP₃ 11.76 150.85 2.30 139.09 TBM

TP₄ 11.40 162.00 0.25 150.60

TP₅ 11.67 172.87 0.80 161.20

TP₆ 11.54 183.86 0.55 172.32

TP₇ 11.90 194.90 0.86 183.00

TP₈ 11.60 206.32 0.17 194.72

TP₉ 11.55 217.58 0.19 206.13

TP₁₀ 7.34 224.64 0.38 217.30

TP₁₁ 8.93 233.05 0.52 224.12

TP₁₂ 4.30 229.82 7.53 225.52

TP₁₃ 5.13 231.03 3.92 225.90 226.59

MP₁ 130.82 4.75 226.28 Casing

MP₂ 22.53 5.17 225.86 Grd.

106.29

Pasco Co. August 13, 1970

Owner - I. A. Krusen & Hamilton
Growers

BM - T255-R21E - Common

Cor of Secs 22, 23, 26 & 27.

Elev. - 118'


Sum-Rod

Mark-Level

Location - T255 R21E

Sec. 22 SE $\frac{1}{4}$ of NE $\frac{1}{4}$

(d, b)

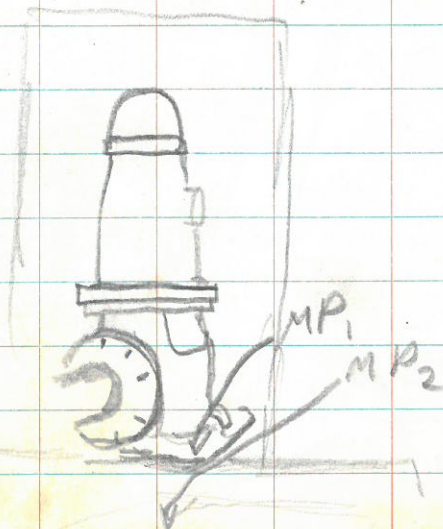

INDEX

PAGE	WELL#	PAGE	WELL#
1	6300	18	8211
2	7826	19	8508
3	6845	20	8429
4	7635	21	4408
5	Bass#1	22	4697
6	Live Oak Quarry	23	10352
7	Ellaville#3	24	5486
8	Ellaville#4	25	6040
9	4114	26	McLeod Quarry
10	10299	27	Brooksville Quarry
11	8604	28	Top of Rock
12	10354	29	McDonald Quarry
13	10319	30	Camp Quarry
14	5759	31	8318
15	7737	32	7801
16	4205	33	6840
17	8426	34	5865

79

PAGE	WELL#	PAGE	WELL#
35	3284	52	6556
36	3965	53	6562
37	3404	54	5694
38	10396	55	6234
39	8188	56	7674
40	8021	57	8507
41	3675	58	5977
42	4410	59	10298
43	Lansing Quarry	60	5282
44	2876	61	6504
45	4158	62	5092
46	6627	63	3512
47	10301	64	4754
48	8699	65	5271
49	8427	66	5829
50	7664	67	5089
51	4830	68	5272 7648

PAGE WELL#

69 8863

70 7651

71 8488

72 7650

73 8862

74 8509

75 10339

76 7802

77 5863

78 2160

6.13. 25.10 ~~18.97~~ 18.97

4.81 20.29