


BENCHMARK EA SOUTH

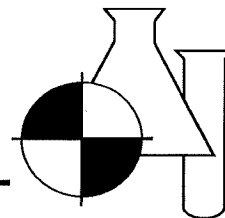

ANALYTICAL TEST REPORT

THESE RESULTS MEET NELAC STANDARDS

NELAC Certification # E85086

Submission Number S 18060587

Florida Dept Of Env Protection
2600 Blair Stone Rd
Tallahassee, FL 32399

Project Name : RQ-2018-06-11-35
Date Received : 06/25/2018
Time Received : 1330

Submission: S 18060587

Sample Number: 001 Sample Description: Cleveland Cemetery G3SD0076
Sample Date: 06/25/2018 Sample Method: Grab
Sample Time: 1010

Parameter	Result	Units	MDL	PQL	Procedure	Preparation Date Time	Analysis Date Time	Analyst
ENTEROCOCCI	3873	#/100ML	10	10	ENTEROLERT	06/25/2018 15:31	06/26/2018 15:55	MM

Submission: S 18060587

Sample Number: 002 Sample Description: Alligator @ Jacaranda G2SD0026
Sample Date: 06/25/2018 Sample Method: Grab
Sample Time: 1115


Parameter	Result	Units	MDL	PQL	Procedure	Preparation Date Time	Analysis Date Time	Analyst
E- COLI BY IDEXX QUANTITRAY	426	#/100ML	10	10	SM9223B	06/25/2018 15:18	06/26/2018 15:50	MM

Submission: S 18060587

Sample Number: 003 Sample Description: Woodmeor Creek G2SD0027
Sample Date: 06/25/2018 Sample Method: Grab
Sample Time: 1135

Parameter	Result	Units	MDL	PQL	Procedure	Preparation Date Time	Analysis Date Time	Analyst
ENTEROCOCCI	1334	#/100ML	10	10	ENTEROLERT	06/25/2018 15:31	06/26/2018 15:55	MM

BENCHMARK EA SOUTH

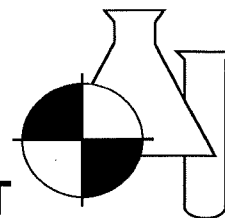

ANALYTICAL TEST REPORT

THESE RESULTS MEET NELAC STANDARDS

NELAC Certification # E85086

Submission: S 18060587

Sample Number: 004

Sample Description: Englewood Ditch G2SD0022

Sample Date: 06/25/2018

Sample Method: Grab

Sample Time: 1210

Parameter	Result	Units	MDL	PQL	Procedure	Preparation		Analysis		Analyst
						Date	Time	Date	Time	
E- COLI BY IDEXX QUANTITRAY	110	#/100ML	10	10	SM9223B	06/25/2018	15:18	06/26/2018	15:50	MM

Submission: S 18060587

Sample Number: 005

Sample Description: Trailer Park Canal G3SD0072

Sample Date: 06/25/2018

Sample Method: Grab

Sample Time: 1250

Parameter	Result	Units	MDL	PQL	Procedure	Preparation		Analysis		Analyst
						Date	Time	Date	Time	
ENTEROCOCCI	10 U	#/100ML	10	10	ENTEROLERT	06/25/2018	15:31	06/26/2018	15:55	MM

Submission: S 18060587

Sample Number: 006

Sample Description: Trailer Park Canal G3SD0072


Sample Date: 06/25/2018

Sample Method: Grab

Sample Time: 1250

Parameter	Result	Units	MDL	PQL	Procedure	Preparation		Analysis		Analyst
						Date	Time	Date	Time	
FECAL COLIFORM	10 U	#/100 ML	10	10	SM9222D	06/25/2018	15:58	06/26/2018	16:00	MM

BENCHMARK EA SOUTH

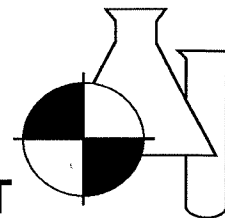

ANALYTICAL TEST REPORT THESE RESULTS MEET NELAC STANDARDS

NELAC Certification # E85086

Melinda Merchant

07/03/2018

Dale D. Dixon / Laboratory Director
Melinda Merchant / Laboratory Manager

Date

DATA QUALIFIERS THAT MAY APPLY:

A = Value reported is an average of two or more determinations.

B = Results based upon colony counts outside the ideal range.

H = Value based on field kit determination. Results may not be accurate.

I = Reported value is between the laboratory MDL and the PQL.

J0 = All Quanti-Tray wells were positive. Result may be higher than reported.

J1 = Est. value surrogate recovery limits exceeded.

J2 = Est. value. No quality control criteria exists for component.

J3 = Est. value quality control criteria for precision or accuracy not met.

J4 = Est. value. Sample matrix interference suspected.

J5 = Est. value. Data questionable due to improper lab or field protocols

K = Off-scale low. Value is known to be < the value reported.

L = Off-scale high. Value is known to be > the value reported

N = Presumptive evidence of presence of material.

Q = Sample held beyond accepted hold time(15 minutes for pH).

T = Value reported is < MDL. Reported for informational purposes only and shall not be used in statistical analysis.

U = Analyte analyzed but not detected at the value indicated.

V = Analyte detected in sample and method blank.

Y = Analysis performed on an improperly preserved sample. Data may be inaccurate.

Z = Too many colonies were present (TNTC); the numeric value represents the filtration volume.

? = Data rejected and should not be used. Some or all of QC data were outside criteria, and the Presence or absence of the analyte cannot be determined from the data.

! = Data deviate from historically established concentration ranges.

* = Not reported due to interference.

NOTES:

PQL = 4xMDL. Except for Micro PQL=MDL

X = Value exceed MCL.

1 dilution was performed on each E.coli and Entero sample.
3 dilutions were performed for the Fecal Coliform sample.

For questions and comments regarding these results, please contact Melinda Merchant at (941) 625-3137

These results relate only to the samples included in this report.

Benchmark EnviroAnalytical, Inc.

1001 Corporate Ave. Suite 102
North Port, FL 34289
(941) 625-3137 / (941) 240-3071 fax

Client Name: FDEP

Address: 2600 Blair Stone Rd.
Tallahassee, FL, 32399

Phone: (850) 245-8085**Email:** dep-overflowmicro@dep.state.fl.us**Bill to: Frances Moore****P.O. #: Lab B16970**

Project Name: RQ-2018- 06-11-35

Project Run/Location: Gators at Ditches Charlotte

Laboratory Submission #:

S18060587

Station ID	Surface Water Sample Matrix ² (Fresh / Marine) Sample Type	Enterococci E.coli (SM9223B Quantitray)	Laboratory Sample #
		E.Coli = 250 mL ; Entero = 120 mL ; Fecal Coliform = 120 mL	
Cleveland Cemetery G3SD0076	F / M / Grab	E.coli / Entero / F.coli 6/25/18 1010	1
Alligator @ Jacaranda G2SD0026	F / M / Grab	E.coli / Entero / F.coli Date & Time: 6/25/18 1115	2
Woodmeor creek G2SD0027	F / M / Grab	E.coli / Entero / F.coli Date & Time: 6/25/18 1135	3
Englewood Ditch G2SD0022	F / M / Grab	E.coli / Entero / F.coli Date & Time: 6/25/18 1210	4
Trailer park Canal G3SD0072	F / M / Grab	E.coli / Entero / F.coli Date & Time: 6/25/18 1250	5
Trailer park Canal G3SD0072	F / M / Grab	E.coli / Entero / F.coli Date & Time: 6/25/18 1250	6
	F / M / Grab	E.coli / Entero / F.coli Date & Time:	
	F / M / Grab	E.coli / Entero / F.coli Date & Time:	
	F / M / Grab	E.coli / Entero / F.coli Date & Time:	
	F / M / Grab	E.coli / Entero / F.coli Date & Time:	
	F / M / Grab	E.coli / Entero / F.coli Date & Time:	

1. "Sample Type" is used to indicate whether the sample was a grab (G) or whether it was a composite (C).

2. "Sample Matrix" is used to indicate whether the sample is being discharged to drinking water (DW), groundwater (GW), surface water (SW), fresh surface water (FSW), saline surface water (SSW), soil, sediment (SDMNT), or sludge (SLDG).

3. "Container Type" is used to indicate whether the container is plastic (P) or glass (G).

4. Sample must be refrigerated or stored in wet ice after collection. The maximum temperature during storage should be 6°C (42.8°F). Under "Preservative," list any preservatives that were added to the sample container.

Instructions:

1. Each bottle has a label identifying sample ID, premeasured preservative contained in the bottle, sample type, client ID, and parameters for analysis.

2. The following information should be added to each bottle label after collection with permanent black ink: date and time of collection, sampler's name or initials, and any field number or ID.

3. All bottles not containing preservative may be rinsed with appropriate sample prior to collection.

4. The client is responsible for documentation of the sampling event. Please note special sampling events on the sample custody form.

Laboratory Sample Acceptability:

pH < 2 : 0 BEAS Temperature: 3.0°C

1	Collector: Gary Snerck	Date: 6/25/18	Time: 1330	Received By: Melinda Marchant	Date: 6/25/18	Time: 1330
2	Relinquished by:	Date:	Time:	Received By:	Date:	Time:
3	Relinquished by:	Date:	Time:	Received By:	Date:	Time:
4	Relinquished by:	Date:	Time:	Received By:	Date:	Time:
5	Relinquished by:	Date:	Time:	Received By:	Date:	Time:

h to h
page 4 of 4