



FLORIDA DEPARTMENT OF ENVIRONMENTAL PROTECTION STRATEGIC MONITORING PROGRAM FIELD SHEET

January 2018

Data Qualified?

Yes / No

WIN Station Name: Padgett Branch @ 441

Date: 01/22/2018

(mm/dd/yyyy)

WIN/ Field ID: G3SE0020 G3SE0026

WBID: 3152B

Latitude: 27.650007

(Decimal Degrees)

County: Okeechobee

ORG ID: 21FLWPB

Longitude: -80.857854

(Decimal Degrees)

Receiving Body of Water: Lake blue cypress

RQ-2018- 01-22-58

Sampling Team Members					WQ Measurements	Sample Collection	Documentation	Preservation	Preservation Check
Skaggs									
Sewell									
Miranda									

Sampling Equipment		
☒ Sample Container	☐ Van Dorn	☐ Pole
☐ Carboy	☐ Syringe	
☐ Dipper	☐ Other	
Depth Measured with <u>YSI</u>		
Equipment ID		

Collection Method		
☐ Wading	☐ Canoe/Kayak	
☒ From Shore	☐ Electric Motor	
☐ Other	☐ Gasoline Motor	

Water Level: Dry/ Pooled/ Low / Normal / High / Flooded

Meter ID# 61605 Matrix: Fresh / Marine / DI

Photos: Yes / No Flow: No Flow / Intertidal / Flowing / NA Tide: Rising/ Falling/ Slack/ NA Tide Times: High Low

Time Zone	Time	Total Depth (m)	Sample Depth (m)	Secchi Disk (m)	DO (mg/L)	DO (%SAT)	pH	Salinity (PPT)	Sp COND (umhos/cm)	Temp. (C°)
EST	11:40	0.1	0.05	0.1	6.15	67%	5.43	0.06	126	19.17
CEN										

Biological Samples Collected: None HA SCI RPS Algae ID LVS LVI Other:

SBIO ID Numbers: SBIO-ID: HA-ID: RPS-ID: Macrophyte-ID: LIMS#:

Parameter Suite	Parameter Methods	Preservation	Lot#	Expiration	pH Check
Preserved Nutrients	☒ W-NH3 / W-NO2NO3 / W-TKN / W-TOC / W-S-A-TP	☒ Ice ☒ H2SO4	<u>7233030</u>	<u>8/24/18</u>	☒ <2
Metals	☐ W-JCPMS ☐ W-ICP	☐ Ice ☐ HNO3			☐ <2
Filtered Nutrients	☒ W-PO4-F ☒ Field Filtered 0.45 um Filter	☒ Ice			
Chlorophyll	☒ CHLSUITE-W	☒ Ice			
Physical/Aggregate (Fresh)	☒ Alkalinity / W-F / W-TSS / TURBIDITY / W-Cl-IC / W-COLOR / W-SO4-IC / W-TDS	☒ Ice			
Physical/Aggregate (Marine)	☐ Alkalinity / W-F / W-TSS / TURBIDITY	☐ Ice			
Macroinvertebrates	☐ MI-FW-QLDC	☐ Formalin			
Periphyton	☐ ALGAE-ID	☐ Ice			
Microbiology	☒ E Coli ☐ F Coli ☐ Enterococci	☒ Ice			
Molecular	☐ PCR-FILTER ☐ PCR-HF183 ☐ PCR-BacR ☐ PCR-GULL2 ☐ PCR-GFD	☐ Ice			
Tracers	☐ W-SUC-AA-R ☐ W-UHERB-AA ☐ W-AHERB-AA	☐ Ice			
Pesticides	☐ W-PSNP-TQ ☐ W-UHERB-AA ☐ W-AHERB-AA ☐ W-CARB-AA ☐ W-PCL-SQ-R ☐ W-PYR-AA-R ☐ W-GLYPH ☐ W-SUC-AA-R	☐ Ice ☐ Other			

Notes:

A

Place Label Here

Signature: [Signature]

Date: 1/22/18

Enter Field Parameters, Verify Station ID In LIMS DMT: Am 04/20/18

QC Station ID, Field Parameters In LIMS DMT:

Scan/Save Field Sheets

(Initials/Date)

Migrate Data to WIN:

(Initials/Date)

Verify Data In WIN:

(Initials/Date)

(Initials/Date)

DEP Form FD 9000-5 Stream/River Habitat Assessment Field Sheet

SAMPLING AGENCY: <u>21FLWPB</u>		STORET STATION NUMBER:	DATE (MM/DD/YY): <u>10/04/18</u>	RECEIVING BODY OF WATER:
REMARKS:	COUNTY: <u>OKEECHOBEE</u>	LOCATION: <u>SWEETWATER BRANCH</u>		FIELD ID/NAME: <u>G3SE0025</u>

Habitat Parameter	Optimal	Suboptimal	Marginal	Poor
Primary Habitat Components	Four or more major productive habitats present (snags, tree roots, aquatic vegetation, leaf packs (partially decayed), rock)	Three major productive habitats present. Adequate habitat. Some substrates may be new fall (fresh leaves or snags)	Two major productive habitats present. Less than desirable habitat, frequently disturbed or removed	One or less major productive habitat. Lack of habitat is obvious, substrates unstable or smothered
Substrate Diversity <u>4</u>	20 19 18 17 16	15 14 13 12 11	10 9 8 7 6	5 <u>4</u> 3 2 1
Substrate Availability <u>5</u>	Greater than 30% major productive habitat present at site 20 19 18 17 16	16% to 30% major productive habitat, by aerial extent 15 14 13 12 11	6% to 15% major productive habitat 10 9 8 7 6	Less than 5% major productive habitat <u>5</u> 4 3 2 1
Water Velocity <u>5</u>	Max. observed at typical transect: > 0.25 m/sec. But < 1 m/sec ≥0.33 0.31 0.29 0.27 >0.25 20 19 18 17 16	Max. observed at typical transect: >0.1 to 0.25 m/sec 0.25 0.21 0.17 0.13 >0.1 15 14 13 12 11	Max. observed at typical transect: 0.05 to 0.1 m/sec 0.1 0.09 0.07 0.06 0.05 10 9 8 7 6	Max. observed at typical transect: <0.05 m/sec; or spate occurring: > 1 m/sec <0.05 0.04 0.03 0.01 <0.01 <u>5</u> 4 3 2 1
Habitat Smothering <u>7</u> ----- Primary Score <u>21</u>	Adequate number of stable pools (1-2 per 12 times width) and <25% of habitats affected by sand, silt, or algae. 20 19 18 17 16	Adequate number of stable pools (1-2 per 12 times width) and >25% of habitats affected by sand, silt, or algae. 15 14 13 12 11	Does not have required number of stable pools (1-2 per 12 x width) and/or has shallow pools (<2 x prevailing depth). 10 9 8 <u>7</u> 6	Stable pools are absent. Most habitats affected by sand, silt, or algae accumulation. 5 4 3 2 1
Secondary Habitat Components	Expected sinuosity given the stream width. No evidence of dredging or artificial straightening. No spoil banks.	Good sinuosity within old channelized area. Evidence of dredging in the past (>25 yrs) but mostly recovered.	Straightened with trapezoidal cross section, but has a small degree of sinuosity developed within channelized area.	Straightened or engineered by dredging, has trapezoidal or box cut cross section, lacks required pools. May have spoil banks.
Artificial Channelization <u>18</u>	20 19 <u>18</u> 17 16	15 14 13 12 11	10 9 8 7 6	5 4 3 2 1
Bank Stability	Bankfull > 60% of bank height. Slope of bank ≤ 60° from bankfull to top of bank. Bankfull is within or above the root zone with few raw, eroded areas.	Only meets 2 of the 3 requirements for optimal bank stability.	Only meets 1 of the 3 requirements for optimal bank stability.	Bankfull < 60% of bank height. Slope of bank > 60°. Bankfull is below the root zone with raw, eroded areas.
Right Bank <u>9</u> Left Bank <u>10</u>	10 9	8 7 6	5 4	3 2 1
Riparian Buffer Zone Width	Width of vegetation greater than 18 m	Width of vegetation >12 to 18m	Width of vegetation 6 to 12 m. human activities close to system	Less than 6 m of buffer zone due to intensive human activities
Right Bank <u>10</u> Left Bank <u>10</u>	10 9	8 7 6	5 4	3 2 1
Riparian Zone Vegetation Quality	Over 80% of riparian surfaces consist of normal, expected plant community for given sunlight & habitat conditions (e.g., native plants; tree, shrub, and forbs represented, if appropriate). Minimal disturbance.	>50% to 80% of riparian zone is undisturbed (normal, expected plant community for given sunlight & habitat conditions). Some disruption in community observed.	25% to 50% of riparian zone is undisturbed (normal, expected plant community for given sunlight & habitat conditions). Disruption obvious.	Less than 25% of riparian zone is undisturbed (normal, expected plant community for given sunlight & habitat conditions).
Right Bank <u>6</u> Left Bank <u>9</u> ----- Secondary Score <u>72</u>	10 9	8 7 6	5 4	3 2 1

93

TOTAL SCORE

Date: <u>10/04/2018</u>	Analyst: <u>SKAGGS</u>	Signature: 
-------------------------	------------------------	--

DEP FORM FD 9000-25 Rapid Periphyton Survey Field Sheet

Site: <u>Sweetwater Branch</u>					County: <u>Okeechobee</u>		Date: <u>10/04/2018</u>		Investigators: <u>SKAGGS/SEWELL</u>	
STORET Station Number: <u>G3SE0025</u>										

Transect (m)	Point 1=right 9=left	Algal Thickness Rank (N-6, X)	Estimated	Canopy Cover	Transect (m)	Point 1=right 9=left	Algal Thickness Rank (N-6, X)	Estimated	Canopy Cover	
0	1	N	N		60	1	N	N		
	2					2				
	3					3				
	4					4				
	5			45		5			52	
	6					6				
	7					7				
	8					8				
	9					9				
10	1				70	1				
	2					2				
	3					3				
	4					4				
	5			75		5			45	
	6					6				
	7					7				
	8					8				
	9					9				
20	1				80	1				
	2					2				
	3					3				
	4					4				
	5			72		5			77	
	6					6				
	7					7				
	8					8				
	9					9				
30	1				90	1				
	2					2				
	3					3				
	4					4				
	5			74		5			91	
	6					6				
	7					7				
	8					8				
	9					9				
40	1				100	1				
	2					2				
	3					3				
	4					4				
	5			85		5			95	
	6					6				
	7					7				
	8					8				
	9					9	N	N		
50	1				Record "N" and check "Estimated" for points deeper than the Secchi depth; algae are presumed absent. Check "Estimated" if thickness estimated for deep points which can be seen but not reached. Record "X" for points shallower than Secchi depth for which substrate cannot be seen or reached with the hand. No estimated rank. Record canopy cover as the number of small densiometer quadrants (out of 96) that HAVE canopy cover. Measure facing upstream at point 4, 5, or 6. Collect algal mat sample following DEP SOP FS 7240 if the percentage of total sampled points with a thickness rank of 4, 5, or 6 is >20%.					
	2									
	3									
	4									
	5			75						
	6									
	7									
	8									
	9	N	N							


Secchi depth	
Estimated?	

# points ranked 4-6	3
total points assessed	
% points ranked 4-6	0

Check accompanying data collected at same site/date.	
Algal mat sample	
Linear Veg Survey	X
Habitat Assessment	X
SCI/Biorecon	
Water sample	X
RQ- <u>2018-10-01-80</u>	

Algal Thickness Rank	
N	rough, no algae, slimy, algae up to 1mm
3	>1mm - 6mm
4	>6mm - 20mm
5	>20mm - 10 cm
6	>10 cm

DEP Form FD 9000-4 Stream/River Habitat Assessment Sketch Sheet

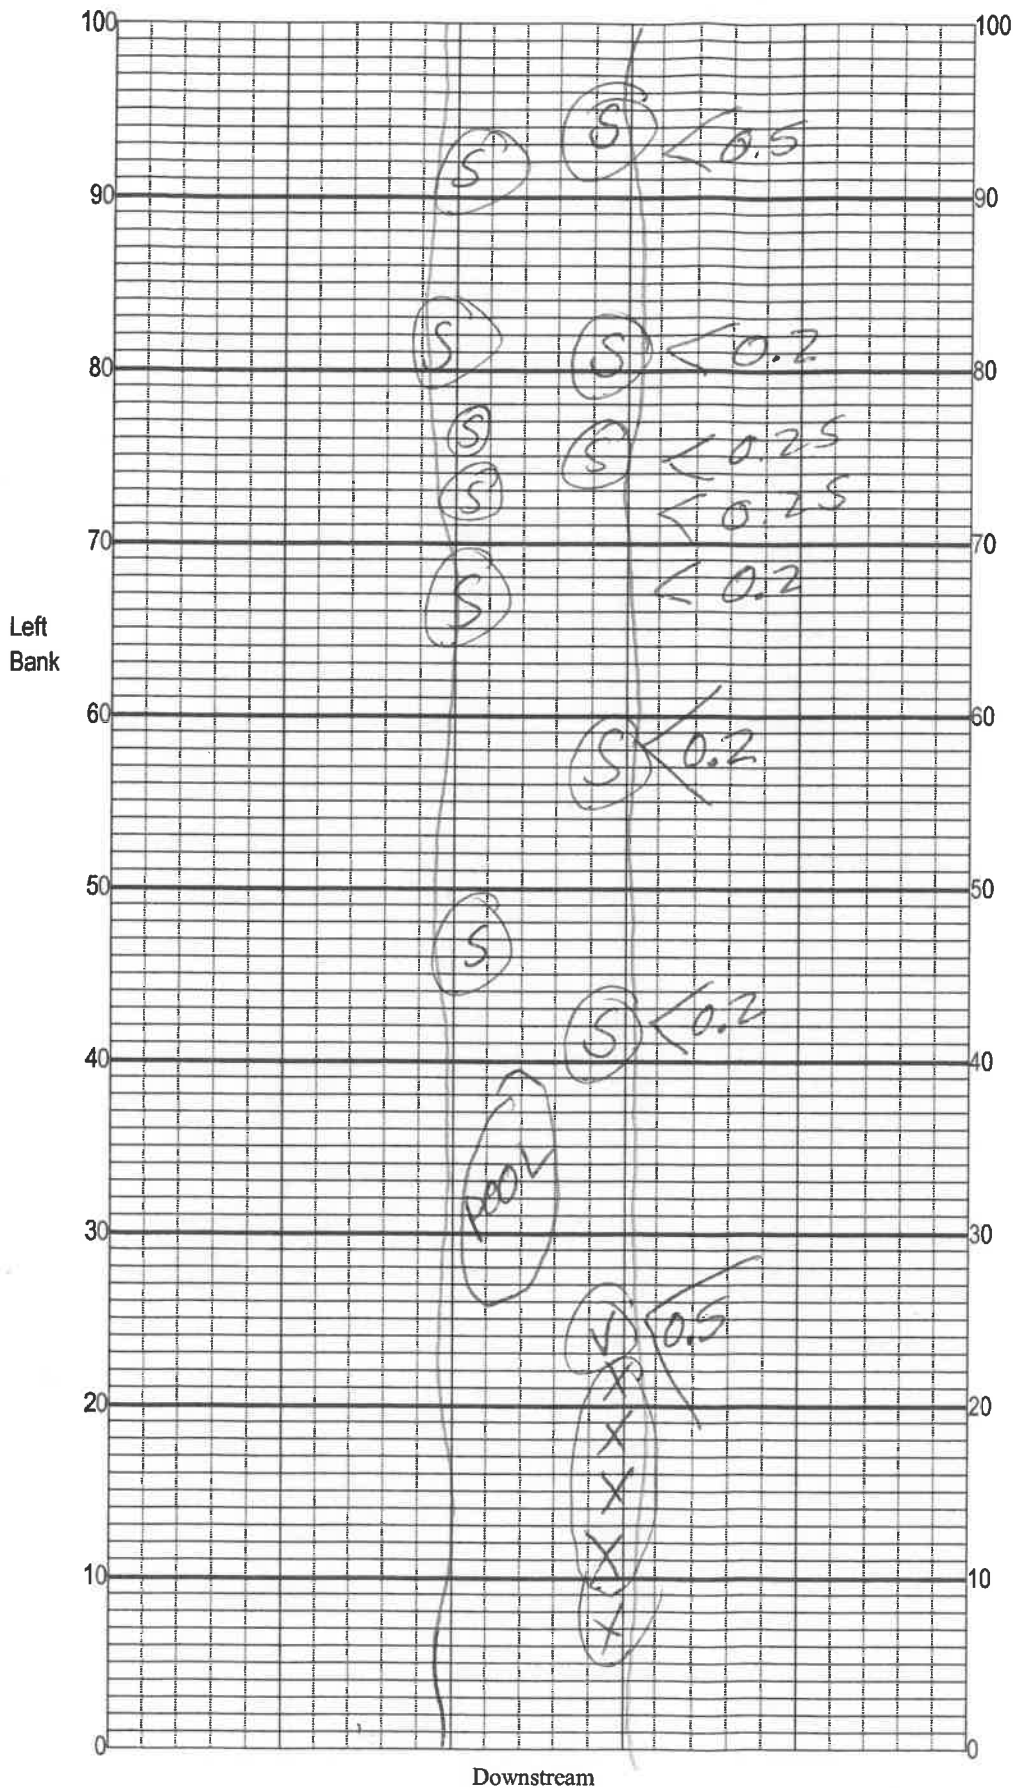

Length of grid represents 100 m of stream (not linear meters).
(Horizontal scale is double vertical scale, draw proportionately).

Location: Sweetwater Branch

Date: 10/04/2018

Sampler: SKAGGS/SEWELL

100 m: Latitude 27.570
Longitude -80.834

0 m: Latitude 27.571
Longitude -80.833

Substrates: Code key, draw proportionate habitat abundance. %

☒ S Snags 1.2 %

☐ Roots/undercut banks _____

☐ Leaf Packs (or mats) _____

☒ V Aquatic Macrophytes 0.3 %

☐ _____

☐ _____

☒ Pools total # observed = 1
range expected = ~5-11

Average width 1.5 m

Average depth 0.2 m

Velocity measured at 50 meter mark.

WQ & chemistry taken at 0 meter mark.

Habitat Smothering:
Note areas (on map) where sand or silt is smothering substrates, limiting habitability.

Bank Stability:
Note areas (on map) with unstable, eroding banks.

Riparian Buffer Width:
Note areas (on map) where natural vegetation is altered or eliminated.

Plants observed / other notes:

V - 0.5 12 x 1.5 = 18

S - 1.8

- low water levels with larger, snags (only partially submerged)

Waterbody: Sweetwater Branch	Date: 10/4/18	County: Okeechobee	Storet Number:
Analyst: SKAGGS/SCWELL	Signature:		
Comments: less than 2 m ² wet			

[illegible]

$< 2m^2$ weg

Fall 7