


# Report

## Solid Waste Authority of Palm Beach County

Proposed Monitoring Plan  
for the North County Regional  
Resource Recovery Facility

August 1994

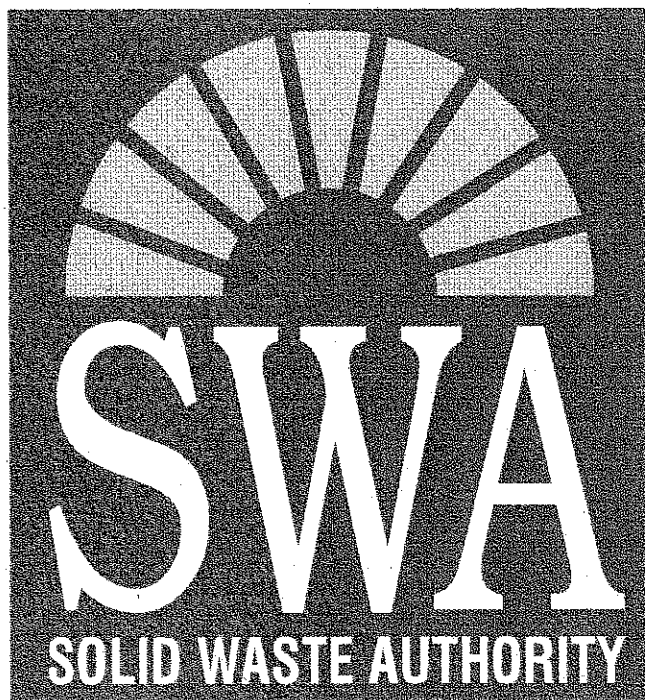

SOLID WASTE AUTHORITY OF  
PALM BEACH COUNTY

PROPOSED MONITORING PLAN  
FOR THE NORTH COUNTY REGIONAL  
RESOURCE RECOVERY FACILITY

AUGUST 1994

Prepared for:

Solid Waste Authority of Palm Beach County  
7501 North Jog Road  
West Palm Beach, FL 33412

Prepared by:

Camp Dresser & McKee Inc.  
1601 Belvedere Road, Suite 211  
West Palm Beach, FL 33406

Wesley A. Curtis  
10/3/94

Wesley A. Curtis  
Florida Registered Professional  
Geologist No. 1218

Lee P. Wiseman  
10/3/94

Lee P. Wiseman  
Florida Registered Professional  
Engineer No. 43448



environmental engineers, scientists,  
planners, & management consultants

CAMP DRESSER & McKEE INC.

1601 Belvedere Road, Suite 211 South  
West Palm Beach, Florida 33406  
407 689-3336, Fax: 407 689-9713

---

November 8, 1994

HAND DELIVERED

Mr. Joseph Kahn, P.E.  
Solid Waste Supervisor  
Florida Department of Environmental Protection  
Southeast District  
P.O. Box 15425  
West Palm Beach, Florida 33416

Subject: Solid Waste Authority of Palm Beach County  
North County Regional Resource Recovery Facility  
Power Plant Site Certification No. PA 84-20  
Water Quality Monitoring Plan

Dear Mr Kahn:

On behalf of the Solid Waste Authority of Palm Beach County (SWA) and in accordance with condition XIV.E. of the above referenced certification, Camp Dresser & McKee (CDM) is pleased to submit two copies of the North County Regional Resource Recovery Facility (NCRRRF) proposed water quality monitoring plan for the Department's review and approval. This plan was prepared in accordance with Rule 17-701.510, Florida Administrative Code (F.A.C.), effective May 1994.

Should you have any questions or comments on this plan, please do not hesitate to contact our office.

Very truly yours,

CAMP DRESSER & McKEE INC.

Alex H. Makled, P.E.

AHM/mjm  
Enclosure

File: 2678-02-RT[5]

cc: Richard Statom, w/o enclosure  
David Lowe, P.E., w/o enclosure

mm0452



2678-02  
①

# Department of Environmental Protection

Lawton Chiles  
Governor

Southeast District  
P.O. Box 15425  
West Palm Beach, Florida 33416

Virginia B. Wetherell  
Secretary

CERTIFIED MAIL  
RETURN RECEIPT REQUESTED

December 2, 1994

Mr. Richard Statom  
PBCSWA  
7501 North Jog Road  
West Palm Beach, FL 33417

Palm Beach County  
SW - Site 7  
Permit Files

Dear Mr. Statom:

This is to acknowledge receipt of the Proposed Groundwater Monitoring Plan revisions dated August 1994, received by the Department on November 9, 1994 for your facility.


- [ ] This letter constitutes notice that a permit will be required for your project pursuant to Chapter(s) \_\_\_\_\_, Florida Statutes.
- [ ] Your application for permit is complete as of \_\_\_\_\_ and processing has begun. You are advised that the Department under Chapter 120, Florida Statutes, must take final action on your application within ninety (90) days unless the time is tolled by administrative hearing.
- [ ] Your application for permit is incomplete. Please provide the information listed on the attached sheet(s) promptly. Evaluation of your proposed project will be delayed until all requested information has been received.
- [ ] The additional information received on \_\_\_\_\_ was reviewed, however, the item(s) listed on the attached sheet(s) remain incomplete. Evaluation of your proposed project will continue to be delayed until we receive all requested information.
- [X] At this time no permit is required for your project by this Department. Any modifications in your plans should be submitted for review, as changes may result in permits being required. This letter does not relieve you from the need to obtain any other permits (local, state or federal) which may be required. The groundwater monitoring plan revisions are complete as submitted.

If you have any questions, please contact me at telephone number 407-433-2650 of this office.

Sincerely,

*Joseph Lurix*  
Joseph Lurix, Engineer  
Solid Waste Section

cc: Alex Makled, CDM\*

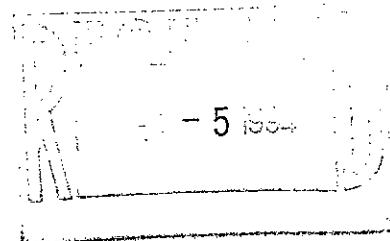

I N T E R O F F I C E   M E M O R A N D U M

Date: 01-Dec-1994 02:45pm EST  
From: Cher Petro WPB  
PETRO\_C  
Dept: Southeast District Office  
Tel No: 407-433-2650  
SUNCOM: 232-2650

TO: Joe Kahn WPB ( KAHN\_J )  
CC: Joe Lurix WPB ( LURIX\_J )  
CC: Paul Wierzbicki WPB ( WIERZBICKI\_P )  
CC: Hamilton Buck Oven TAL ( OVEN\_H @ A1 @ DER )

Subject: WQMP for NCRRRF

Subject: Proposed Monitoring Plan for the North County Regional Resource Recovery Facility, Solid Waste Authority of Palm Beach County, dated August 1994 and received on November 9, 1994, prepared by Camp Dresser & McKee.

The Waste Cleanup Section has reviewed the referenced document. The document was found to be complete, thoroughly addressing all of the requirements of Rule 62-701.510, F.A.C. for water quality monitoring (surface water, groundwater and leachate water quality parameters and sampling frequencies), monitoring well placement and spacing, assessment monitoring and corrective actions, and water quality reporting requirements; and, therefore, the proposed monitoring plan is approved.

## TABLE OF CONTENTS

| <u>Section</u>                                                                                 | <u>Page</u> |
|------------------------------------------------------------------------------------------------|-------------|
| 1.0 INTRODUCTION AND BACKGROUND .....                                                          | 1-1         |
| 1.1 Site Location and Description .....                                                        | 1-1         |
| 1.2 Overview of the Landfill's Historical Operation .....                                      | 1-2         |
| 1.3 Permits .....                                                                              | 1-2         |
| 1.4 Purpose and Scope .....                                                                    | 1-2         |
| 2.0 HYDROGEOLOGY AND HYDROLOGY .....                                                           | 2-1         |
| 2.1 Regional Hydrogeology .....                                                                | 2-1         |
| 2.1.1 Hydrogeology .....                                                                       | 2-1         |
| 2.1.2 Groundwater Flow Patterns in the Surficial Aquifer ....                                  | 2-3         |
| 2.2 Site-Specific Hydrogeology of the Surficial Aquifer .....                                  | 2-3         |
| 2.2.1 Geology .....                                                                            | 2-3         |
| 2.2.2 Aquifer Hydraulics .....                                                                 | 2-4         |
| 2.2.3 Historical Groundwater Elevations .....                                                  | 2-5         |
| 2.2.4 Shallow Groundwater Flow Patterns .....                                                  | 2-6         |
| 2.2.5 Deeper Groundwater Flow Patterns .....                                                   | 2-7         |
| 2.2.6 Comparison of Shallow and Deep Groundwater<br>Elevations at Selected Well Clusters ..... | 2-8         |
| 2.3 Conceptual Groundwater Flow Model .....                                                    | 2-9         |
| 2.4 Rainfall and Evapotranspiration .....                                                      | 2-9         |
| 2.5 Overview of Surface Water Management .....                                                 | 2-12        |
| 2.6 Conceptual Steady-State Groundwater Budget .....                                           | 2-13        |
| 2.7 Surface Soil Characteristics .....                                                         | 2-15        |
| 2.8 Well Inventory .....                                                                       | 2-17        |
| 3.0 WATER QUALITY .....                                                                        | 3-1         |
| 3.1 Background Groundwater Quality .....                                                       | 3-1         |
| 3.2 Background Surface Water Quality .....                                                     | 3-2         |
| 3.3 Operational Groundwater Quality .....                                                      | 3-3         |
| 4.0 EXISTING ONSITE MONITORING PROGRAM .....                                                   | 4-1         |
| 4.1 Monitor Well Locations and Construction Details .....                                      | 4-1         |
| 4.2 Surface Water Monitoring .....                                                             | 4-1         |
| 4.3 Leachate Monitoring .....                                                                  | 4-3         |

## TABLE OF CONTENTS (continued)

| <u>Section</u>                                | <u>Page</u> |
|-----------------------------------------------|-------------|
| 5.0 PROPOSED MONITORING PLAN .....            | 5-1         |
| 5.1 Groundwater Monitoring .....              | 5-1         |
| 5.1.1 Proposed Monitor Well Locations .....   | 5-1         |
| 5.1.2 Monitor Well Construction Details ..... | 5-3         |
| 5.1.3 Initial Sampling .....                  | 5-5         |
| 5.1.4 Routine Monitoring .....                | 5-5         |
| 5.1.5 Assessment Monitoring .....             | 5-7         |
| 5.1.6 Corrective Actions .....                | 5-8         |
| 5.2 Surface Water Quality Monitoring .....    | 5-8         |
| 5.3 Leachate Monitoring .....                 | 5-10        |
| 5.4 Water Quality Data Reporting .....        | 5-10        |
| 6.0 CONCLUSIONS AND RECOMMENDATIONS .....     | 6-1         |
| 7.0 REFERENCES .....                          | 7-1         |

### APPENDICES

|            |                                                                                                                          |
|------------|--------------------------------------------------------------------------------------------------------------------------|
| Appendix A | Site and Vicinity Characterization Chapter from the 1985 Application for Power Plant Site Certification                  |
| Appendix B | Construction Details, Survey Data, and Historical Groundwater Elevations                                                 |
| Appendix C | Historical Monthly Rainfall Totals for the Palm Beach International Airport and the Loxahatchee National Wildlife Refuge |
| Appendix D | 40 CFR Part 258, Appendix I and Appendix II                                                                              |
| Appendix E | 40 CFR Part 261.24                                                                                                       |